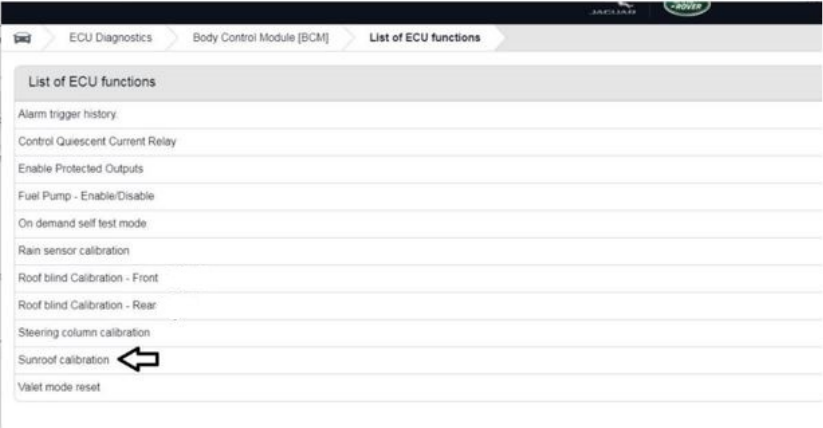


Diagnostics and Testing		
Symptom Chart		
Symptom	Possible causes	Action
<p>Glass panel will bounce back (anti trap activating) when glass is closed by one touch. This can occur when glass is closing from tilt or when glass panel contacts Wind Deflector.</p>	<p>Panorooft Motors have not Initialised to in car fit conditions</p>	<p>Ensure vehicle engine is running throughout entire process, (Power Mode 7), Re initialise Panorooft system using Path Finder system. Use VCI Adaptor to plug into the OBD port on the vehicle. Follow the routine below.</p> <p>(At present, Manual Re initialisation process will not function. Corrective Action for this will be introduced shortly. Assured Vin TBC).</p> 
<p>Any Glass Panel changes / removals, Side Finisher Removals / wind deflector removals</p>		