

Technical Service Bulletin

20 Noises from the fuel line

20 20 27 2059997/1 July 7, 2020.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q3	2019 - 2021	All	Not Applicable

Condition

Customer states:

 There is a droning/vibrating noise from the right half of the vehicle (sometimes in the dash panel area, B pillar or rear).

Workshop findings:

 The fuel lines in the longitudinal member start to vibrate in certain operating situations and this creates the noise.

Technical Background

Due to pressure pulsation from the high-pressure pump on engine side the underfloor line in the underbody tunnel vibrates. This vibration causes noise that can also be heard in the vehicle interior.

Production Solution

Not applicable.

Service

- 1. Remove the underbody cover.
- 2. Fill the fuel line tunnel or the space around the line with closed-pore foam (foam that doesn't soak up water) part number 321 201 299. This means the fuel line does not have to be removed.



Technical Service Bulletin

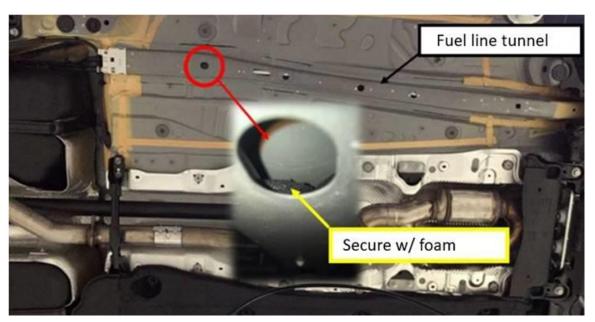


Figure 1. Location of fuel line of vibration.

4. Reinstall the underbody cover.

Warranty

	T	The state of the s					
Claim Type:	• 110 up to 48 Months/50,000 Miles.						
	G10 for CPO Covered Vehicles – Verify Owner.						
	If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.						
Service Number:	2038						
Damage Code:	0020						
Labor Operations:	Remove and install underbody	5193 1900	See SRT				
	Secure fuel line with foam	2029 1399	10 TU				
Diagnostic Time:	GFF	No allowance	0 TU				
	Road test prior to the service procedure	0121 0002	10 TU				
	Road test after the service procedure	0121 0004	10 TU				



Technical Service Bulletin

Claim Comment:	As per TSB #2059997/1
Ciaiiii Coiiiiileiit.	A3 per 130 #2009391/1

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.						
Part Number	Part Description	Quantity				
See ETKA	Fasteners, Bolts, Nuts, and Screws as needed per the Repair Manual	See ETKA/ELSA				
321201299	Foam	0.5				

Additional Information

All part and service references provided in this TSB (2059997) are subject to change and/or removal.

©2020 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.