



Technical Service Bulletin

Technical Service Bulletin: TSB200147**Released Date: 25-Jun-2020****Idle Shutdown During Regen**

Idle Shutdown During Regen

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- X15 CM2450 X124B

Issue

Symptom:

- Engine idle shut down interrupts a stationary aftertreatment regen.

Root Cause:

- ECM calibrations released on March of 2020 do **not** allow the stationary aftertreatment regen to overcome the idle shut down.

Verification

Verify current ECM calibration is March 2020. Reference ECM Calibration Revision History on Quickserve® Online for more information.

Resolution

Calibrate ECM using an April 2020, or later, INCAL DVD. Reference ECM Calibration Revision History on Quickserve® Online for more information.

Document History

Date	Details
2020-6-25	Module Created

Last Modified: 25-Jun-2020

