

## **SSM 48969 - 2020 Explorer/Aviator - Vehicles May Exhibit a Perceived Lack of Power Brake Assist or Extended Brake Pedal Travel at Initial Startup**

Some 2020 Explorer/Aviator vehicles may exhibit a perceived lack of power brake assist or extended brake pedal travel at initial vehicle start up with diagnostic trouble code (DTC) C0047:64 stored in the anti-lock brake system (ABS) module. The vehicle may also exhibit an illuminated ABS, Advance Trac, and/or red brake warning lamp, and possible Advance Trac Fault message displayed. This may be caused by the software in the ABS module. To correct the condition, reprogram the ABS module using the latest software level of the appropriate Ford diagnostic scan tool. For claiming, use causal part 2005 and applicable labor operations in Section 10 of the Service Labor Time Standards (SLTS) Manual.

APPLICABLE VEHICLES  
2020 EXPLORER  
2020 AVIATOR