

**SSM 49042 - 2020 Explorer/Aviator – Perceived Soft/Low Brake Pedal At Engine Start-Up - Illuminated Brake Warning With DTC C0047:64 - Built On Or Before 15-Jul-2020**

Some 2020 Explorer/Aviator vehicles built on or before 15-Jul-2020 may exhibit a perceived soft/low brake pedal at initial vehicle start up with diagnostic trouble code (DTC) C0047:64 stored in the anti-lock brake system (ABS) module. The vehicle may also exhibit an illuminated ABS, Advance Trac, and/or red brake warning lamp, and possible Advance Trac Fault message displayed. This may be due to the software in the ABS module. To correct the condition, reprogram the ABS module using the latest software level of the appropriate Ford diagnostic scan tool. For claiming, use causal part 2005 and applicable labor operations in Section 10 of the Service Labor Time Standards (SLTS) Manual.

APPLICABLE VEHICLES

2020 CAR: TV U611N AVIATOR

2020 CAR: TW U625N EXPLORER