

# WLD0 Workshop campaign - Replacing high-voltage line between high-voltage distributor and E-box

Version 2

## Overview

It is possible that the single-wire seal in the connector housing of the high-voltage line between the high-voltage distributor and E-box was fitted incorrectly on the affected vehicles.

This can result in a conductive medium entering the connector housing in some cases. Malfunctions may occur depending on the amount of penetration and a red warning message appears in the instrument cluster.

To prevent this from happening, the high-voltage line between the high-voltage distributor and E-box must be replaced.

Please arrange for this measure to be carried out on the affected vehicles during the next workshop visit.

Model type	Taycan (Y1A)
Model year	2020
Number	591

## Required parts and materials

Parts required:

Part No.	Designation	Quantity/vehicle	Parts return*
9J1971131A	High-voltage wire harness	1 ea.	No
PAF106825	Cheese head bolt, M8 x 50 – Strut to body	4 ea.	No

Required materials: (only if required)

Part No.	Designation	Quantity/vehicle	Parts return*
00004330516	Coolant additive, 20-litre container – Cooling system	As much as required (approx. 1 litre required per vehicle)	No

\* The parts must be stored until such a time as the related warranty or campaign claim has been credited. If a barcode is generated with the credit note, the affected part must be sent to Porsche AG as usual. If no barcode is generated with the credit note, the part can go directly into the genuine remanufactured parts process or be scrapped.

## Parts Availability and Ordering

Parts stock is currently at 50%. Please only order parts as required for vehicles in the workshop requiring the repair, or appointments made.

As parts are limited, please do not order additional parts, outside of what is required.

## Warranty processing

### Validity:

This workshop campaign will be carried out up to 26.06.2025 and will be closed by the specified date.

Please note that warranty claims can only be processed before this date.

### Scope 1:

Damage code	WLD0 66 000 2
Working time	957 TU

Please enter the campaign that was carried out in the Warranty and Maintenance booklet for the vehicle.

## Porsche Mobility

If requested, the mobility of the affected customer can be assured by offering a suitable replacement vehicle. Please invoice this additional service with the campaign scope via WWS.

## Further information

Work instruction	TI No. 77/20, Group 2, Service, WLD0
Vehicle list and allocation	See PCSS or attached VIN List for reference
Technical Information*	See PCSS or attached TI for reference

[WLD0 VIN List.xlsx](#)

**20.0 KB**

(112 views)

[Y1A 77-20 WLD0 Replacing High-Voltage Line  
Between High-Voltage Distributor and E-Box  
\(Workshop Campaign\).pdf](#)

**80.5 KB**

(140 views)

Created by [Ryan Cooney](#) on Jul 29, 2020 7:36 PM. Last modified by [Ryan Cooney](#) on Jul 29, 2020 7:42 PM.

Categories: [Taycan](#), [Workshop Campaigns](#)

Tags : [taycan](#), [y1a](#), [wld0](#), [high voltage line](#)

650 Views

[Report Abuse](#)

### Content and Topics

[Your Groups](#) >

[Your Content](#) >

[Your Places](#) >

### Personal

[Edit Profile](#) >

[Change Password](#) >

### Manage

[Admin Console](#) >

[PPN Administration](#)>

### Create

[Discussion](#) >

[Files](#) >

[Document](#) >

[Collaboration](#) >

#### Document

[Blog Post](#) >

[Poll](#) >

[Event](#) >

[Photo Album](#) >

[Idea](#) >

Space >

Group >

© 2020 Dr. Ing. h.c. F. Porsche AG. [Legal notice.](#) [Copyright.](#) [Terms of use.](#) [Privacy Policy.](#) [Cookie Policy.](#) **009**