

Latest Vehicle Concern Fixes

POWERTRAIN



Care Point- Turbo Replacements	17-19MY F-PACE, XE, XF, Velar equipped with AJ20D4 & 16-20MY RR Rover, RR Sport, Discovery 3.0L TDV6 Engines
<p><u>Technical Description:</u></p> <ul style="list-style-type: none"> Vehicle returns after turbo replacement requiring either another turbo replacement or seemingly an engine replacement <p><u>Care Point:</u></p> <ul style="list-style-type: none"> Ensure that ALL missing pieces of the turbo have been found and recovered from the system. This could be a missing impeller nut, pieces of the impeller itself or other damaged metal components Drain the intake track, intercooler of all ingested oil 	

