

Service Bulletin

Bulletin No.: 20-NA-121

Date: June, 2020

TECHNICAL

Subject: Water Leak at Rear Roof Area

Brand:	Model:	Model Year:		VIN:		Engino	Transmission:
		from	to	from	to	Engine:	Transmission.
Buick	Encore GX	2020	2020	SOP	March 15, 2020	All	All
Chevrolet	Trailblazer	2021	2021			All	All

Involved Region or Country	North America		
Condition	Some customers may comment on a water leak in the rear of the vehicle and/or water found in the spare tire area.		
Cause	ALL		
	The cause of the condition may be a pin hole in the roof to body seam.		

The cause of the condition may be a pin hole in the roof to body seam.



Correction

Inspect for a leak and repair as necessary.

5615611

Service Procedure



5613597

If you encounter a vehicle with the above condition, inspect the rear cargo interior trim, headliner, and spare tire area for signs of a water leak.

Once the water leak is found, repair any damage that may have been done due to the water leak.

Once the damage is repaired, apply seam sealer along the roof to body seam to correct the condition.

Parts Information

Causal Part	Description	Part Number	Qty
N/A	Kent® High-Tech Seam Sealer Clear	P10200	1
	C)r	
N/A	Wurth Euroseal Gel Clear	18920104 (892.0104 in Canada)	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
0560032	Body Joint Resealing	Use Published Labor Operation Time

Version	1
Modified	Released June 03, 2020

