

# **Service Bulletin**


# TECHNICAL

#### Subject: Check Engine Lamp Illuminated, DTC P159F 00 Set, No Audio

Brand:	Model:	Model Year:		Date Breakpoint:		Engine:	Transmission:
		from	to	from	to	Engine.	Transmission.
Buick	Encore GX	2020	2020	SOP	March 6, 2020	All	All
Chevrolet	Trailblazer (VIN M)	2021	2021				


Involved Region or Country	United States, Canada, China, Israel, Korea, Ukraine		
Condition	Some customers may comment on the check engine lamp being illuminated, and no audio from the radio. Technicians may find DTC P159F 00 set.		
Cause	The cause of the condition may be that the X200 connector was not fully connected and locked, resulting in an open circuit.		
Correction	Inspect the X200 IP harness to Body harness connector following the steps in the Service Procedure below.		

## **Service Procedure**

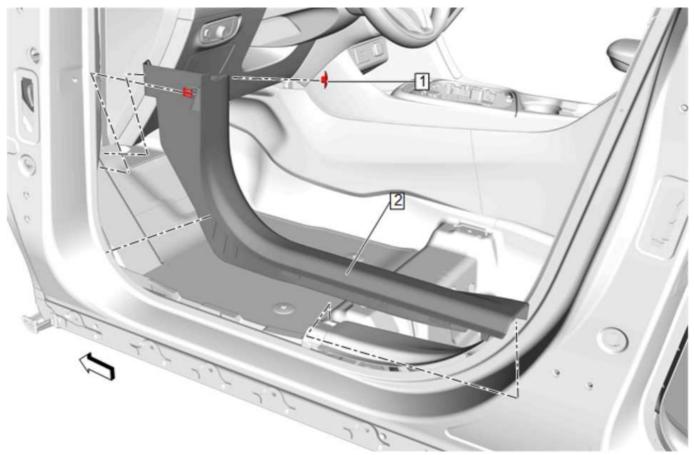

5209005

1. To access the connector, remove the left front side door sill garnish molding (2). Refer to *Front Side Door Sill Garnish Molding Replacement* in SI.

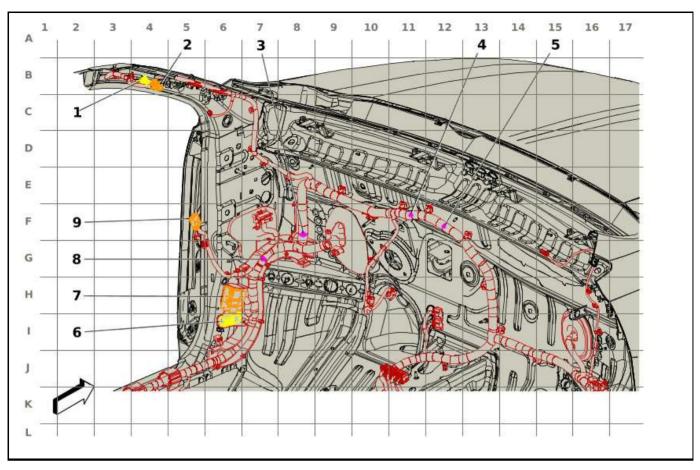


**Note:** First inspect the X200 connection BEFORE disconnecting.

- 2. Inspect the X200 IP harness to Body harness connector (7), located at the lower Left A-Pillar, for possibly not being seated correctly.
- 3. Ensure that the wires are not twisted, not too taut, and the routing is correct.
- 4. Also ensure that the connection is correctly seated on all 4 sides.
- 5. Verify that the condition has been eliminated.

5437484



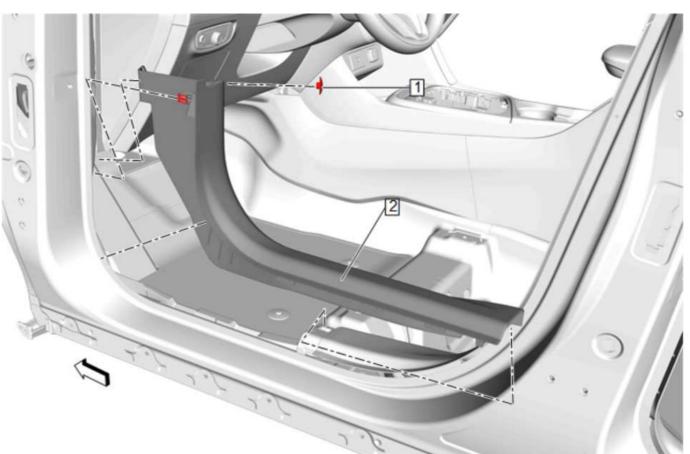

 Reinstall the left front side door sill garnish molding (2). Refer to Front Side Door Sill Garnish Molding Replacement in SI.

### **Parts Information**

No parts are normally required for this repair.

### **Warranty Information**

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
5430922	Connector Reconnection	Use Published Labor Operation Time

Version	1
Modified	Released June 16, 2020

Page 4

5209005