



Bulletin No.: PIT5748
Published date: 06/3/2020

Preliminary Information

PIT5748 Left Trailer Turn Signal Flashes Once And Stops (Without V92)

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Equinox	2018 - 2020	All	All	All	All
GMC	Terrain	2018 - 2020	All	All	All	All

Involved Region or Country:	North America
Additional RPO/s:	Without V92
Condition:	Left trailer turn signal flashes once and stops after installing a trailer hitch on a truck that does not have the V92 trailer package.
Cause:	Incorrect harness used to wire trailer connector.

If the truck is not equipped with option V92 it does not come with the required trailer harness with built in relays to keep from pulling too much current from the BCM. Replacing the BCM will not change this condition and the alteration is not warrantable. To correct, use the harness listed below.

Parts Information

Description	Part Number	Quantity
Trailer Wiring Harness	84215177	1

Warranty Information

No applicable warranty for this modification.

Version History

Version	1
Modified	06/03/2020 - Created on.



GENERAL MOTORS

© 2020 General Motors. All Rights Reserved.