



Preliminary Information

PIT5753 Glove Box Will Not Open When Button Is Pressed

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Blazer	2020	All	All	All	All



Involved Region or Country	North America
Condition	Customers may complain that the glove will not open when the button is pressed.
Cause	Felt tape is on the latch pawl opening in glove box frame.

Correction:

Remove the felt tape from the latch pawl opening in glove box frame. Also remove any adhesive residue left from the felt tape.

Steps to manually open Glove Box in case the electric push button does not open:

1) Remove right hand End Cap

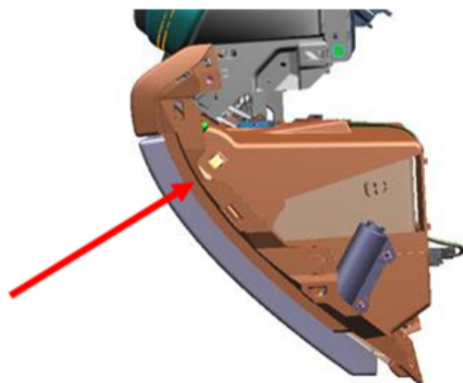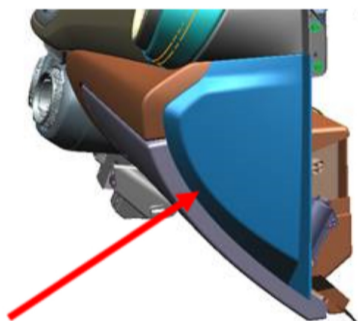

2) Push right hand Rod in-board.

This will un-latch the Glove Box Door and open it.



3) Remove felt tape and any adhesive from felt tape from the rod opening in the Glove Box Frame.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
1086168	Remove felt tape from latch pawl opening in glove box frame.	0.2
*This is a unique Labor Operation for Bulletin use only.		

Version History

Version	1
Modified	06/17/2020 - Created on



© 2020 General Motors. All Rights Reserved.