



Preliminary Information

PIP5095G Fluid In Spark Plug Tubes

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Buick	Enclave	2010 - 2020	ALL	ALL	3.6 LFY, 3.6 LLT	ALL
Buick	LaCrosse	2010 - 2019	ALL	ALL	3.0 LFW, 3.6 LFX, 3.6 LGX, 3.6LLT	ALL
Buick	Regal	2018 - 2020	ALL	ALL	3.6 LGX	ALL
Cadillac	ATS	2013 - 2019	ALL	ALL	3.6 LF4, 3.6 LFX, 3.6 LGX	ALL
Cadillac	CT5	2020	ALL	ALL	3.0 LGY	ALL
Cadillac	CT6	2016 - 2020	ALL	ALL	3.0 LGW, 3.6 LGX	ALL
Cadillac	CTS	2010 - 2019	ALL	ALL	3.0 LF1, 3.0 LFW, 3.6 LF3, 3.6 LFX, 3.6 LGX, 3.6 LLT	ALL
Cadillac	SRX	2010 - 2016	ALL	ALL	3.0 LFW, 3.6 LFX	ALL
Cadillac	XT5	2017 - 2020	ALL	ALL	3.6 LGX	ALL
Cadillac	XT6	2020	ALL	ALL	3.6 LGX	ALL
Cadillac	XTS	2013 - 2019	ALL	ALL	3.6 LF3, 3.6 LFX	ALL
Chevrolet	Blazer	2019 - 2020	ALL	ALL	3.6 LGX	ALL
Chevrolet	Camaro	2010 - 2019	ALL	ALL	3.6 LFX, 3.6 LGX, 3.6 LLT	ALL
Chevrolet	Caprice PPV	2012 - 2015	ALL	ALL	3.6 LFX	ALL
Chevrolet	Captiva Sport	2012 - 2015	ALL	ALL	3.6 LFX	ALL
Chevrolet	Colorado	2015 - 2020	ALL	ALL	3.6 LFX, 3.6 LGZ	ALL
Chevrolet	Equinox	2010 - 2017	ALL	ALL	3.0 LF1, 3.0 LFW, 3.6 LFX	ALL
Chevrolet	Impala	2012 - 2020	ALL	ALL	3.6 LFX	ALL
Chevrolet	Traverse	2010 - 2020	ALL	ALL	3.6 LFY, 3.6 LLT	ALL
GMC	Acadia	2010 - 2020	ALL	ALL	3.6 LGX, 3.6 LLT	ALL
GMC	Canyon	2015 - 2020	ALL	ALL	3.6 LFX, 3.6 LGZ	ALL
GMC	Terrain	2010 - 2017	ALL	ALL	3.0 LF1, 3.0 LFW, 3.6 LFX	ALL

Supersession Statement

This PI was superseded to update Models, model years, and engines. Please discard all copies of PIP5095F

Condition / Concern

Some customers may complain of an SES light with misfire codes or possible oil or coolant leak.

Recommendations / Instructions

On inspection you may find coolant or oil in a spark plug tube.

Determine if the oil or coolant is coming from the spark plug tube and not leaking into it from above.

If the Spark Plug Tube is leaking replace the Cylinder Head, spark plug and coil.

These leaks are caused by porous spots in the head created during manufacturing.

The spark plug tubes are permanently sealed into the head and are not replaceable.

If you replace a cylinder head for this concern, mark the faulty spark plug tube before sending the head in for warranty or core so GM Engineering or the re-manufacturing facility will know where the concern was.

Warranty Information

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4061770	Cylinder Head Replacement - Right Side	Use Published Labor Operation Time
4061790	Cylinder Head Replacement - Left Side	Use Published Labor Operation Time

Additional SI Keywords

P0300 P0301 P0302 P0303 P0304 P0305 P0306



© 2020 General Motors. All Rights Reserved.