



Preliminary Information

PIC6254E Information on Servicing the 1LE Vinyl Hood Wrap

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Camaro	2017 - 2021	All	All	All	All

Supersession Statement

This PI was superseded to update Model Years. Please discard all copies of PIC6254D.

Involved Region or Country	North America
Additional Options (RPO)	Equipped with the 1LE track package, RPOs A1X, A1Y, or A1Z
Condition	All 2017 - 2021 Camaro 1LE cars come equipped with a vinyl hood wrap that is applied before the cars arrive at the dealership. Some dealerships may be looking for additional information on this wrap when it comes to care, cleaning, or in some situations, replacement of the entire hood wrap.
Cause	These hood wraps are all made of a matte finished vinyl material and all of them are black in color. They can be damaged if they are not cared for properly. The most common complaints are smudges or stains that are usually the result of fingerprints, improper cleaning practices, and/or products or leaves that remain on the car and create an outline on the vinyl. In some situations, the customer may even comment about small rips / other physical damage to the wrap itself.

L4 Turbo 1LE



V6 1LE



V8 1LE



ZL1 1LE



Correction:

If any suspect damage is found on one of these hood wraps, dealerships are to first attempt to clean the hood before taking any other action.

Hand washing is recommended using a mild detergent and water. Immediately rinse the vehicle and dry the graphic with a soft squeegee and/or soft cloth to help restore the graphic's luster.

- Touchless car washing systems may be used. To avoid water spotting on graphic, always go through the drying cycle.
- To remove tar and bugs from the graphic, use a commercial cleaner designed for such use, but do not rub vigorously. Immediately wash with a mild detergent / water solution, rinse with water, and dry.

If the concern remains and it's determined a new hood wrap is needed, the 1LE hood wrap (Hood Wrap Decal) can be obtained thru GM Service Parts. All 1LE's use the same part number hood wrap. It will be necessary to cut the holes in the hood wrap to accommodate any hood vents or heat extractors however. The 1LE hood wrap must be installed by a certified "wrap" technician. If your dealership/body shop does not have a certified installer, contact Ryan Scislowicz at Kay Automotive Graphics. His phone number is 248-377-4999, extension 3640. He will be able to direct the dealership to the local certified installer.

If the repairs are covered under the terms of the bumper-to-bumper warranty, photos of the entire car and localized damage to the hood wrap should be taken and submitted as a Field Product Report.

NOTE: The labor times in this PIC have been updated for certain models. The V8 cars have increased labor times as the dealership technician will now be responsible for removing and reinstalling the hood insert / hood vents on the vehicle. This will no longer be done by the "wrap" technician.

Parts Information

Part Number	Description	QTY
84406072	Decal - Hood	1

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	RPO	Labor Time
1480768*	Installation of 1LE Hood Wrap	A1X	3.0 Hr
		A1Y	4.0 Hr
		A1Z	4.0 Hr

* This is a unique labor operation for bulletin use only.

Version History

Version	6
Modified	01/17/2016 - Created on 02/24/2017- Updated Warranty Information 06/16/2017 - Updated Model Years and ZL1 1LE Model 08/27/2018 - Updated Model Years 06/19/2019 - update the V8 labor times 07/23/2020 - to add the 2020-2021 model years



© 2020 General Motors. All Rights Reserved.