

87-20-02TT - A/C Inoperative, No A/C Clutch Operation

Release date:

08/14/2020

Condition

ATTENTION:

THIS IS A TECH TIP, NOT A TECHNICAL BULLETIN. TECH TIPS ARE NOT ASSOCIATED WITH WARRANTY CLAIMING.

Applicable Vehicles						
Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To	
Jetta	2019 - 2020	All	All	All	All	

Revision Table							
Instance Number	Published Date	Version Number	Reason For Update				
2060471/1	8/14/20	87-20-02TT	Original publication.				

Technical Background

Air Conditioning is not blowing cold, no faults in the system. When checked, the amount of refrigerant charge in the system is in specification.

Service

With the A.C. switched ON:

- Check for adequate voltage at the -*N421* Compressor Magnetic Clutch.
- If adequate voltage is not present:
 - Check the wiring harness end connectors at the -*J44* Compressor Clutch Relay for being loose or backed out (Figure 1).

If faulty connections at the -J44- Compressor Clutch Relay are identified:

• Replace the necessary terminal(s) and retest A.C. operation.

If the harness end connectors connections are OK:

• Continue with normal A.C. diagnostics.



87-20-02TT - A/C Inoperative, No A/C Clutch Operation

Release date:

08/14/2020

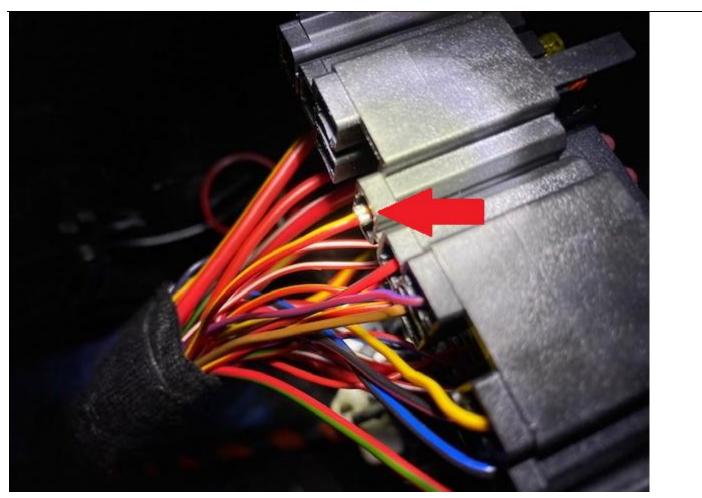


Figure 1:

Additional Information

© 2020 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.