



Service Bulletin


Bulletin No.: 19-NA-068


Date: July, 2020

TECHNICAL

Subject: Malfunction Indicator Lamp (MIL) Illuminated, Intermittent Service Messages, Gauges May Be Erratic - DTCs U0073, U0121, U0100 and/or U0101 Set, G103 Inspection

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Trax	2015	2020	—	—	All	All

Involved Region or Country	North America, Argentina, Brazil, Colombia, Ecuador, Paraguay, Uruguay, China, Korea, Israel, Germany, Saudi Arabia
Condition	Some customers may comment on a MIL illuminated, service messages may be displayed intermittently, and/or gauges may be erratic. Technicians may find DTCs U0073, U0121, U0100 and/or U0101 Set.
Cause	 <p style="text-align: right;">5300153</p>

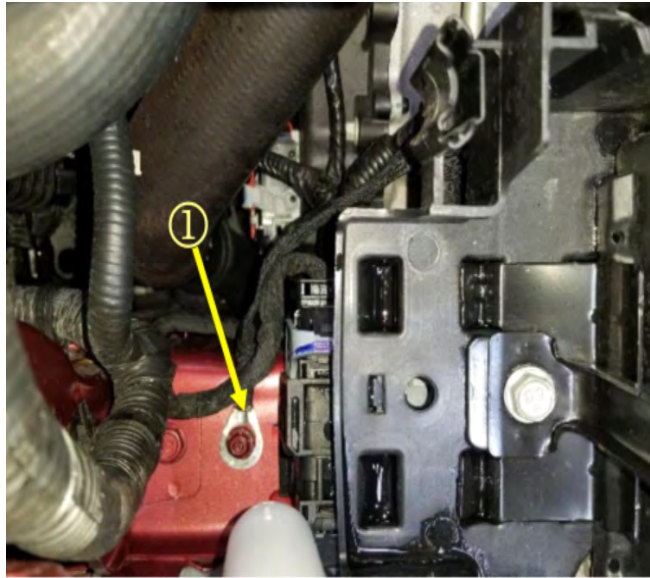

5300152

The cause of the condition may be a poor ground connection at G103 (1), located at the left front frame rail in front of the battery.

Correction

5312724

Important: Check resistance of the stud, as well as the nut and ground eyelet. If equipped with hex shaped/anti-rotational feature, after cleaning, ensure that the eyelet fully seats down onto the stud hex feature before torquing the fastener.

Perform inspection on ground G103; clean and/or remove paint from the grounds contact points and torque fastener to specification.

⇒ Refer to Fastener Specifications in SI.

Parts Information

No parts are normally required for this repair.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
5430962	Ground Connection Repair	Use Published Labor Operation Time

Version	3
Modified	Released April 04, 2019 November 12, 2019 – Removed the Holden Trax model, updated the Involved Region or Country section, updated the Subject and Condition for possible erratic gauges and added Additional Keywords. July 15, 2020 – Added the 2020 Model Year and updated the Involved Region or Country section.

Additional SI Keywords: G103, SES, CEL

