



Service Bulletin


Bulletin No.: 20-NA-128

Date: August, 2020

TECHNICAL

Subject: Fuel Leak Under Vehicle, Fuel Odor

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Equinox	2017	2020	-	-	LH7, LVL, LWW	-
	Express					LWN	
	Malibu					LVL	
GMC	Savana					LWN	
	Terrain					LH7	

Involved Region or Country	North America, Europe, GM Korea (Exclude 2019 Malibu from GM Korea)
Condition	<p>Some customers may comment on one or more of the following conditions:</p> <ul style="list-style-type: none"> Fuel leak under the vehicle Fuel odor <p>Note: There may also be fuel present on component adjacent to the Fuel Filter, Fuel/Water Separator.</p>
Cause 1	This condition may be caused by Fuel leaking at the Fuel/Water Separator Drain Plug Seal as shown in the photo.
Cause 2	This condition may be caused by a fuel leak along the Fuel/Water Separator Body.
Correction 1	 <p>5617297</p> <p>If the source of the Fuel Leak is from the drain plug/seal, replace the drain plug and seal. ⇒ Tighten the fuel filter drain plug to 1.6 N m (14 lb in).</p>
Correction 2	If the source of the fuel leak is along the Fuel Separator Body, please replace the Fuel Filter/Water Separator Assembly. Refer to <i>Fuel Filter Assembly Replacement</i> in SI.

Parts Information

Causal Part	Description	Part Number	Qty
X	PLUG, FUEL FLTR DRN	84428488	1
X	FILTER, FUEL (W/ WAT SEP)	84428489	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
4026770	Fuel Filter Replacement	Use the Published Labor Operations Time
4026790	Fuel Filter Assembly Replacement	

Version	1
Modified	Released July 27, 2020

