



AWNING ADAPTER

Bulletin Type:	Technical Service Bulletin TSB	Publication Date:	August 2020
Bulletin #(s):	20-018	Make(s):	Entegra Coach
Job Code(s):	9801512	Model(s):	Aspire, Anthem, Cornerstone
Flat Rate(s):	.5 Hour	Model Year:	2020

Incident:	The Girard awning may retract when various interior lights are operating.
Affected Units:	Please see the serial number listing at end of the repair instructions.
Parts Kit:	Kit #: 20-018E
	Contents: 2- Pigtail, Sensor motion w/Capacitor (1 per awning) 2 – wire ties (1 per awning)

INSTRUCTIONS


Below shows, the in-line capacitor and zip tie to install to each of the Girard awnings (2). Awnings are located on the passenger side of the motorhome.



1. Extend awnings completely.



- Turn off the **bedroom breaker** on the inverter subpanel located in the overhead cabinet above driver's side seat window.

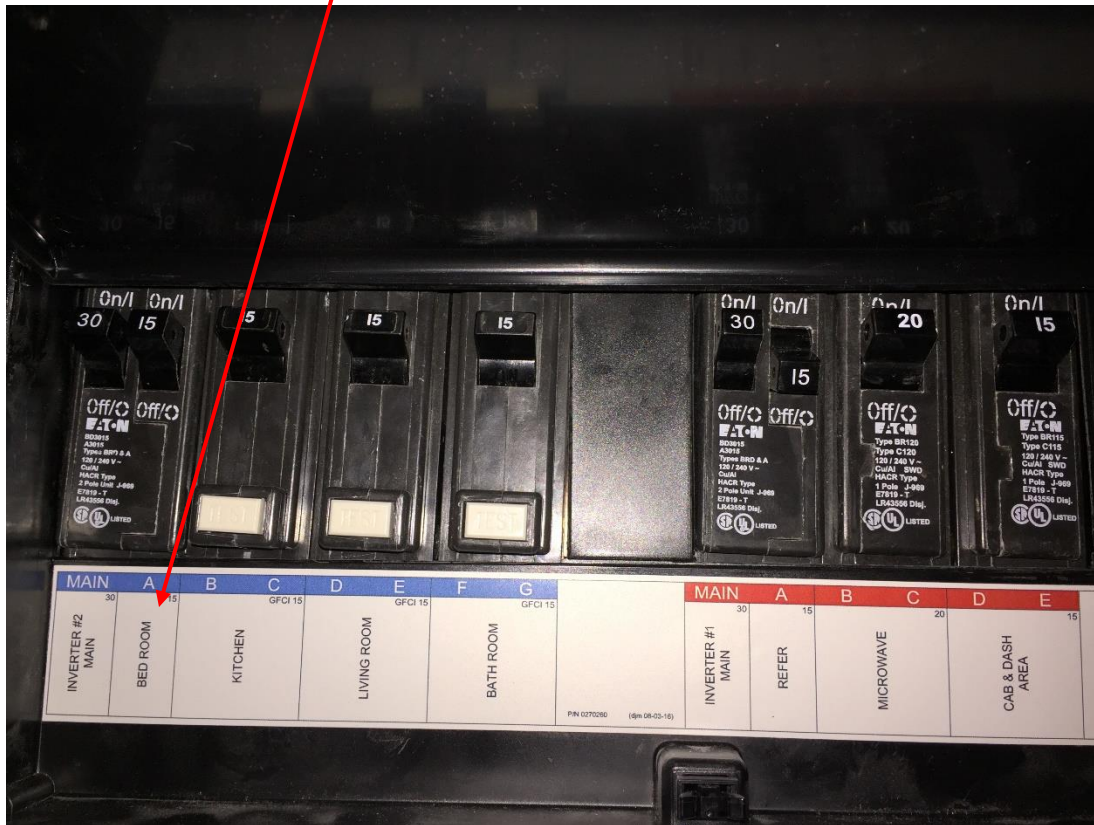

- Locate the Motion Sensor Connector, inside lead rail. (this will be on motor end of awning)



4. Disconnect the Motion Sensor wire.



5. Install the in-line Capacitor between the sensor and harness. (it can only go one way)



6. Secure wiring with zip tie. Be sure the wires are located, to prevent damage when awning is retracted.
7. Repeat installation steps 3-6 adding the in-line capacitor to the second awning.



8. Turn on bedroom breaker in diver's side overhead cabinet.
9. Test awning by gently shaking the lead rail until it starts to retract.

Jayco's sole obligation under our limited warranty is to repair or replace defective materials and/or workmanship deemed our responsibility as determined by Jayco in our sole discretion. Jayco reserves the right to use new and/or remanufactured parts or materials of similar quality to complete any work, and to make parts and/or design changes as appropriate without notice to anyone. Jayco designs and/or materials changes are done without obligation to incorporate such changes in previously manufactured product. Jayco makes every reasonable effort to ensure field remedies will not adversely affect performance and/or safety of the unit. This field remedy is not intended to extend to future performance of this RV, or any of its materials, components or parts beyond the standard warranty period. The RV owner's obligation to notify Jayco, or one of its independent, authorized dealers, of a claimed defect does not modify any obligation placed on the RV owner to contact Jayco directly when attempting to pursue remedies under state or federal law. Jan. 2019.

903 South Main Street • P.O. Box 460 • Middlebury, IN 46540

TSB 20-018 Affected Unit Listing

Aspire	MY	Model	Serial #
	K1	3M	8061
	L1	3B	8051-8080
		3F	8051-8065
		3H	8051-8056
		3M	8051-8055
		3P	8051-8062
		3R	8051-8087
		3W	8051-8080

Anthem	MY	Model	Serial #
	L1	4A	8051-8052
		4B	8051-8085
		4F	8051-8092
		4H	8051-8052
		4W	8051-8093

Cornerstone	MY	Model	Serial #
	K1	6B	8082
	L1	6A	8051-8055
		6B	8051-8079
		6F	8051-8071
		6W	8051-8071
		6X	8051-8058
		6Y	8051-8054