



Technical Service Bulletin

96 Lane change assist/Intersection assist inop, DTC B200047 is stored in one of the corner radars

96 20 55 2060530/1 August 31, 2020.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A8	2018 -2020	All	Lane change assist
Q7, Audi e-tron Sportback	2020	All	Lane change assist
A6, A7, Q8, and Audi e-tron quattro	2019 -2020	All	Lane change assist

Condition

Customer states:

- The intersection/lane changing assist system is inoperable.
- One or more of the following messages are shown in the instrument cluster:
 - “Intersection assist Malfunction! Please go to workshop.”
 - “Lane change and exit warning: Malfunction! Please go to workshop.”
 - “Rear intersection assistant: Malfunction! Please go to workshop.”
 - “Audi pre sense: Malfunction! Please go to workshop.”

Workshop findings:

The following DTC is be stored in one of the corner radars, J769, J770, J1088, and/or J1089 (address word 003C, 00CF, 00DB, and/or 00DC):


- **DTC B200047** (control unit faulty) with symptom codes 1311064 or 1311074.

Technical Background

The diagnostics routine falsely detects a defective control module.

Production Solution

Not applicable.

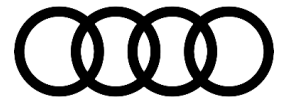

Technical Service Bulletin

Service

Complete the test plan offered by GFF **without replacing any parts**. After completing the test plan, the DTC can be deleted.

Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner.• If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9635		
Damage Code:	0039		
Diagnostic Time:	GFF	0150 0000	Time stated on the diagnostic protocol (Max 30 TU)
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
Claim Comment:	As per TSB #2060530/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All part and service references provided in this TSB (2060530) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2020 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.