



SPYDER 2020 RT LinQ Rack Hard To Turn - 137879

[Printable Version](#)

Rate This Article

(Average Rating: No Rating)

[Version 1](#)

Language

English ▼

[Show Properties](#)**Summary:**

LinQ rack knob might be too hard to turn for 219400973.

Type:


General

TST Detail:**Problem:**


During installation, LinQ knob is impossible or very difficult to turn (Lock/Unlock).

Solution:

- You can use a Torx T25 L-key to Lock/Unlock P/N 529000082

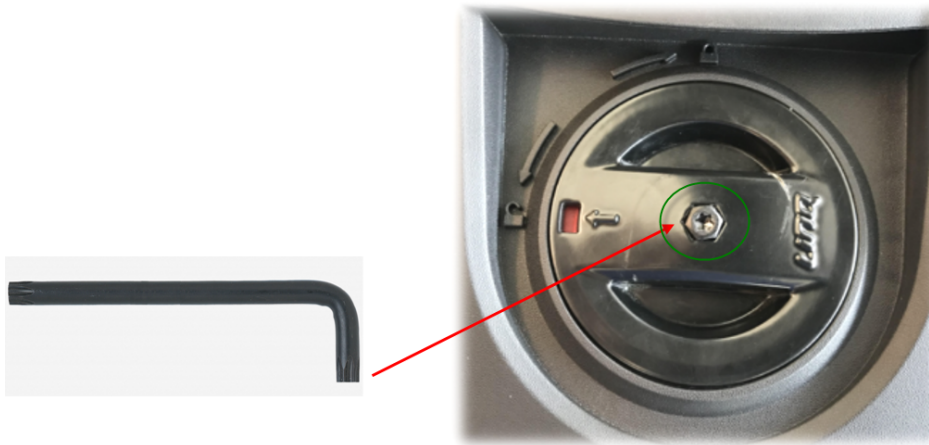**OR**

If the knob doesn't turn or very hard to finalize the rotation by hand, One washer 250200024 can be added to the knob as shown below;

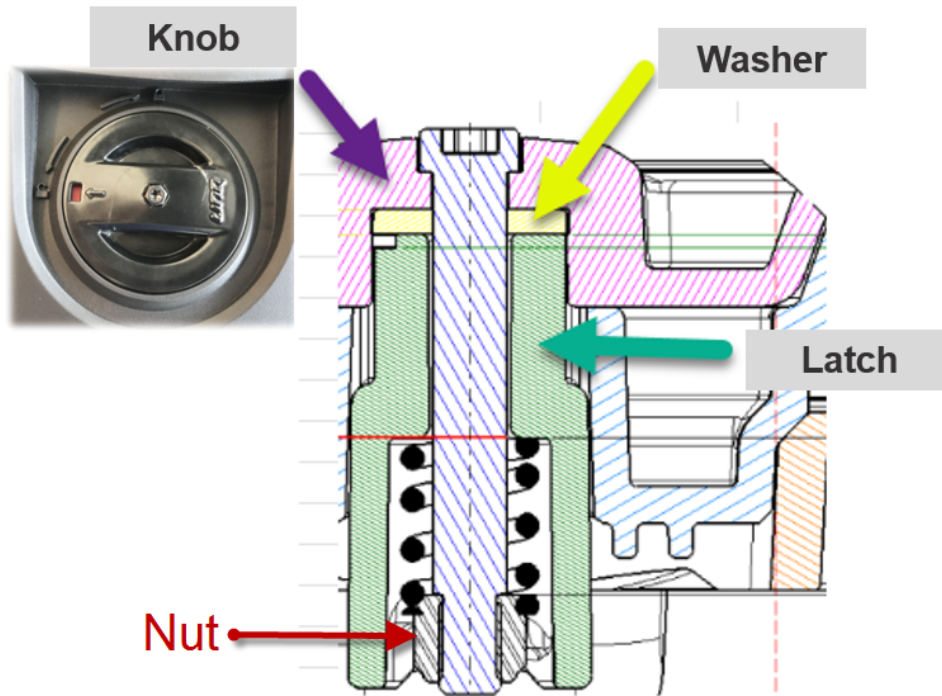



To install this washer, you have to unscrew the nut and disassemble the knob. To re-assemble, install a new nut M5 233251494. The nut must be in contact with the stem. Once the contact is made, apply a torque of 1.8 @ 2.4 Nm, one thread must be visible once the torque is applied.

Note: to achieve a proper clamping, the knob rotation must offer some resistance

If the knob still doesn't turn or it's very hard to finalize the rotation by hand

- Grinding a portion of specific ribs as shown below;

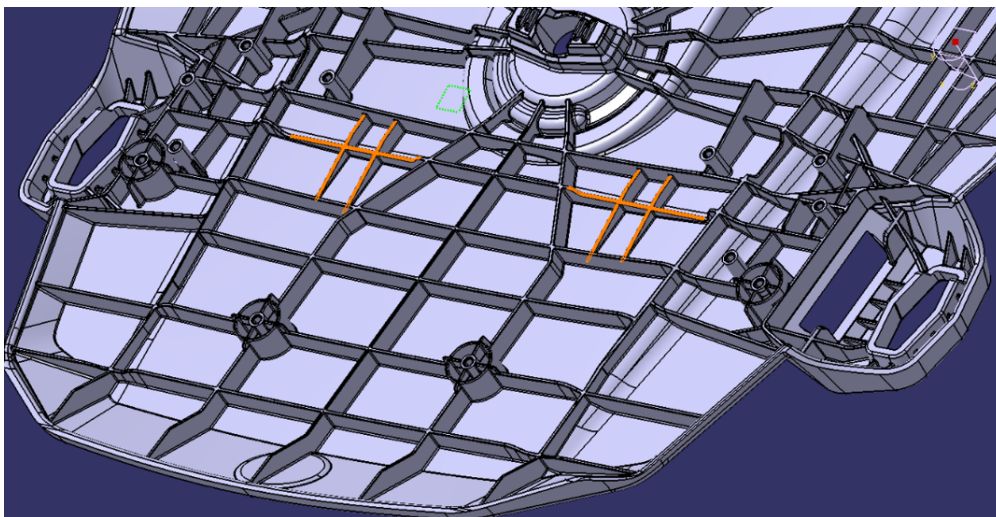

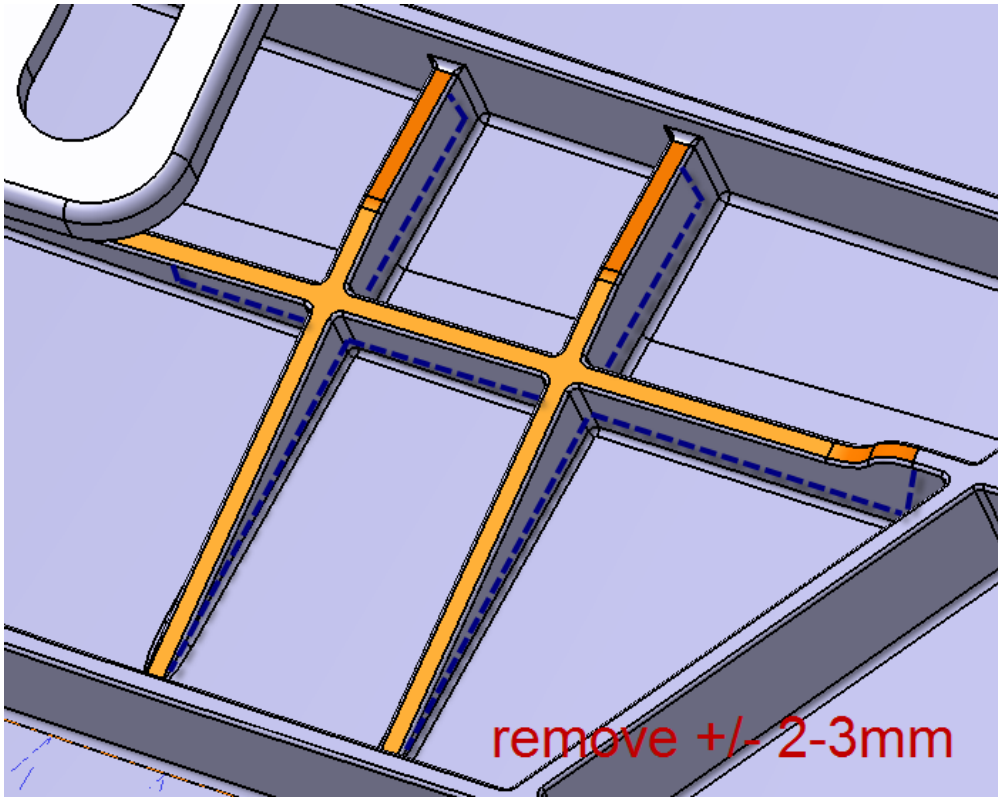

Warranty:

Normal Warranty Applies

Attachment:

First Published By: Eric Fauteux on 2020-07-15

Last Modified By: Eric Fauteux on 2020-07-15