

# WLE7 Workshop campaign - Replacing double clutch transmission

Version 1

## **WLE7 Workshop campaign - Replacing double clutch transmission**

### **Overview**

There is a possibility that the affected vehicles were fitted with a double clutch transmission on which a seal between the transmission bell housing and thrust block is missing. This can result in internal leaks in the double clutch transmission at transmission fluid temperatures greater than 80 °C.

If this happens, it will not be possible to engage any other transmission range initially after engaging transmission range "P" due to the reduced oil pressure. It will not be possible to continue driving until the transmission fluid temperature has cooled down.

To prevent this, the double clutch transmission must be replaced on the affected vehicles.

|                     |                                   |
|---------------------|-----------------------------------|
| <b>Model type</b>   | Panamera (971)                    |
| <b>Model year</b>   | 2018                              |
| <b>Manufactured</b> | between 09.10.2018 and 01.07.2019 |
| <b>Number</b>       | 4                                 |

## Parts required

| Part No.    | Designation   | Quantity/vehicle | Parts return* |
|-------------|---|------------------|---------------|
| 9A7300020DX | 8-speed double clutch transmission<br>Transmission type<br>CODSA - Panamera               | 1 unit           | No            |
| 9A7300020FX | 8-speed double clutch transmission<br>Transmission type<br>CODS1 - Panamera 4             | 1 unit           | No            |
| 9A7300115BX | 8-speed double clutch transmission<br>Transmission type<br>CODS5 - Panamera 4<br>E-Hybrid | 1 unit           | No            |
| 9A7300020CX | 8-speed double clutch transmission<br>Transmission type<br>CODS4 - Panamera GTS           | 1 unit           | No            |
| 9A7300020EX | 8-speed double clutch transmission  | 1 unit           | No            |

| Part No. | Designation                                    | Quantity/vehicle | Parts return* |
|----------|--|------------------|---------------|
|          | Transmission type<br>CODS2 - Panamera<br>Turbo |                  |               |

**Other parts required:**

The other parts required to carry out the campaign can be found in the respective Technical Information (TI).

\* The parts must be stored until such a time as the **related warranty or campaign claim has been credited**. If a **barcode is generated** with the credit note, the affected part must be sent to Porsche AG as usual. If no barcode is generated with the credit note, the part can go directly into the genuine remanufactured parts process or be scrapped.

**Ordering required parts**

Parts are available in required quantity and can be ordered as needed without the need for a PRMS ticket or email release.

**Warranty processing****Validity:**

This workshop campaign will be carried out up to 27.07.2025 and will be closed by the specified date.

Please note that warranty claims can only be processed before this date.

**Scope 1:**

|              |             |
|--------------|-------------|
| Damage code  | WLE7 66 000 |
| Repair code  | 2           |
| Working time | 1231 TU     |

**Scope 2:**

|              |             |
|--------------|-------------|
| Damage code  | WLE7 66 000 |
| Repair code  | 2           |
| Working time | 1245 TU     |

**Scope 3:**

|              |             |
|--------------|-------------|
| Damage code  | WLE7 66 000 |
| Repair code  | 2           |
| Working time | 1666 TU     |

**Scope 4:**

|              |             |
|--------------|-------------|
| Damage code  | WLE7 66 000 |
| Repair code  | 2           |
| Working time | 1584 TU     |

Please enter the campaign that was carried out in the Warranty and Maintenance booklet for the vehicle.

**Porsche Mobility**

If requested, the mobility of the affected customer can be assured by offering a suitable replacement vehicle. Please invoice this additional service with the campaign scope via WWS.

**Further information**

|                             |  |
|-----------------------------|--|
| Work instruction            | TI No. 75/20, Group 3, Service, WLE7                                   |
| Vehicle list and allocation | See PCSS or attached list for reference                                |
| Technical Information*      | See PCSS or <a href="#">Aftersales Document Database</a> for reference |

\* Please find attached the Technical Information as a PDF file. Please bear in mind that this is provided for your information only. The version published in PCSS is the definitive version.

[WLE7 VIN List.xlsx](#)

**8.2 KB**

(177 views)

Created by [Ryan Cooney](#) on Aug 26, 2020 4:07 PM. Last modified by [Ryan Cooney](#) on Aug 26, 2020 4:16 PM.

Categories: Panamera, Workshop Campaigns

Tags : [971](#), [workshop campaign](#), [year j](#), [wle7](#)

790 Views

[Report Abuse](#)

Content and Topics

Personal

Manage

Create

Your Groups >

Edit Profile >

Admin Console >

Discussion >

Your Content >

Change Password >

PPN Administration>

Files >

Your Places >

Document >

Collaboration >

Document

Blog Post >

Poll >

Event >

Photo Album >

Idea >

Space >

Group >

© 2020 Dr. Ing. h.c. F. Porsche AG. [Legal notice.](#) [Copyright.](#) [Terms of use.](#) [Privacy Policy.](#) [Cookie Policy.](#) [009](#)