

SSM 49054

2020 Escape/Corsair - Roof Opening Panel - Flutter, Drone, Hum, And/Or Vibration Noise While Driving

Text:

Some 2020 Escape/Corsair vehicles equipped with a roof opening panel may exhibit a flutter, drone, hum, and/or vibration noise while driving. This may be due to an incorrectly adjusted roof opening panel. Adjust the roof opening panel so that the front edge of the sliding glass panel is contacting the margin seal. Refer to Workshop Manual (WSM), Section 501-17. After adjustment perform a power roof opening panel initialization. Refer to WSM, Section 501-17. For claiming, use causal part 54500A18 and applicable labor times from Section 10 in the Service Labor Time Standards (SLTS) Manual.

Vehicles:

| | |
|------|----------------------|
| 2020 | Corsair (CX483) (TF) |
| 2020 | Escape (CX482) (TC) |