



Thor Motor Coach Technical Service Bulletin

TSB #	TSB 20-05		
Description/Title:	Fog Light Relay		
Affected Product Line(s):	Certain Model Year 2021 Hurricane & Windsport Motorhomes		
Service Campaign # :	RC000193	Released Date:	7/21/2020
Repair Codes:	Repair: TMCTS80261W	Document Date:	7/21/2020
Time Allowed:	Repair: 0.3	Document Revision:	A

Issue:

On certain model year 2021 Hurricane & Windsport Motorhomes built on a 2020 Ford F53 Chassis, the fog light relay will buzz at a certain voltage range. The fix will be to install a harness to the fog light relay.

Part(s) Required:

Relay Harness - **TMC Part #0478627**



Tools Required:


Wire Stripper
Wire Crimper

Repair Instructions:


1. Open hood of the motorhome to locate the fog light relay with white and brown wires near the firewall.




2. Cut Brown wire on relay and strip both ends.

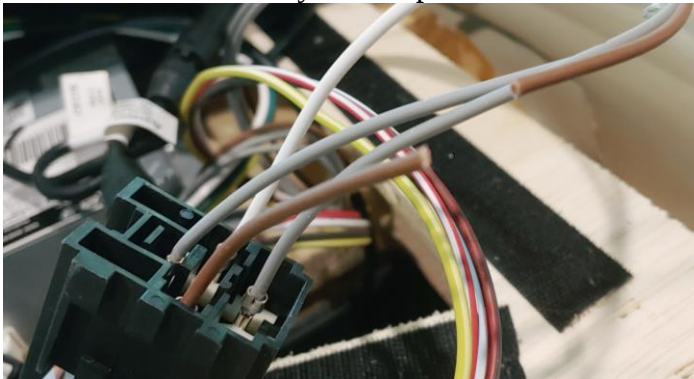

3. Connect the Red ends of the harness to each end of the Brown wire and crimp.

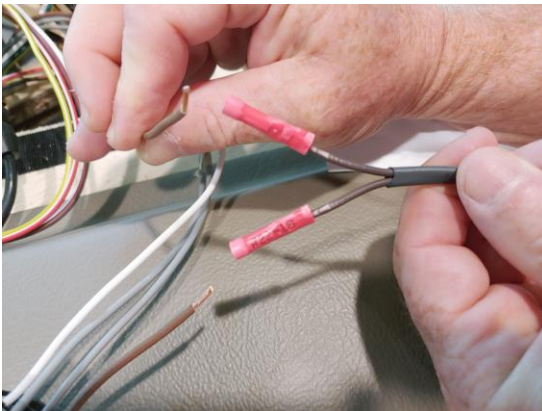

4. Repeat step #4 with Blue ends of the harness with White wire.

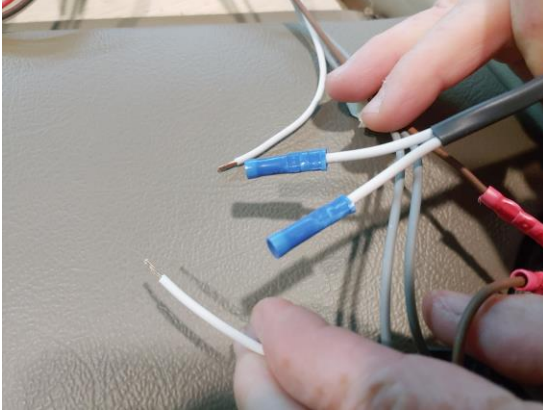

5. This is what it should look like once repair is complete.

