



SIB 61 01 20

2020-08-28

ACCESSORIES DO NOT POWER ON

This Service Information Bulletin (Revision 1) replaces SI B61 01 20 **dated February 2020**.

What's New (Specific text highlighted):

- Procedure

MODEL

| E-Series | Model Description |
|----------|------------------------------------|
| F95 | X5 M SAV (Sports Activity Vehicle) |
| F96 | X6 M SAC (Sports Activity Coupe) |
| G05 | X5 SAV |
| G06 | X6 SAC |
| G07 | X7 SAV |
| G20 | 3 Series Sedan |
| G29 | Z4 Roadster |

SITUATION


Customer is not able to power accessories using the 12 volt power socket.

CAUSE

Design change to reduce short circuits and blown fuses.

CORRECTION

Replace assembly screw in the front 12 V power socket.

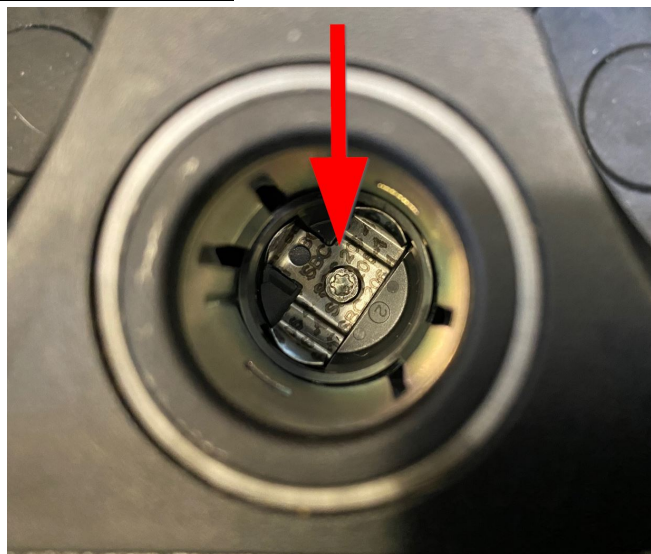
PROCEDURE

1. Remove the fuse that powers the front 12 V power socket. Fuse number and location can be found in ISTA or AIR.


2. Loosen the Torx bolt using a T10 bit driver. DO NOT apply too much downward pressure as this can cause the power socket to come apart underneath.



3. Remove the Torx bolt.

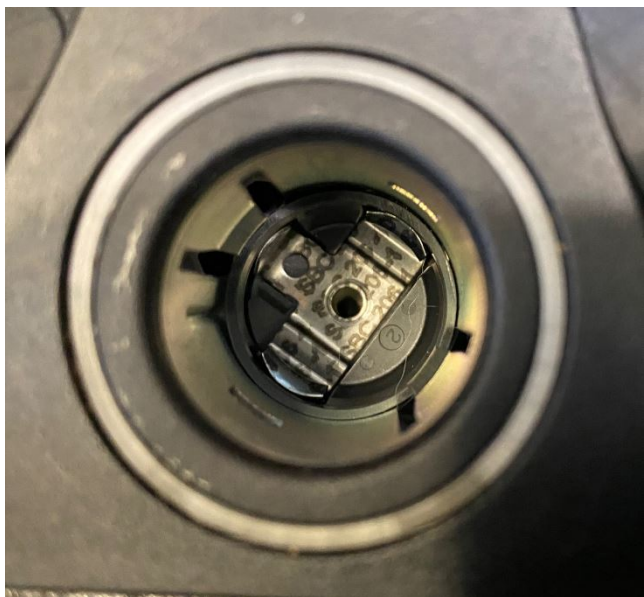

4. Insert the replacement bolt and hand tighten (McMASTER-CARR, item number 91292A112).

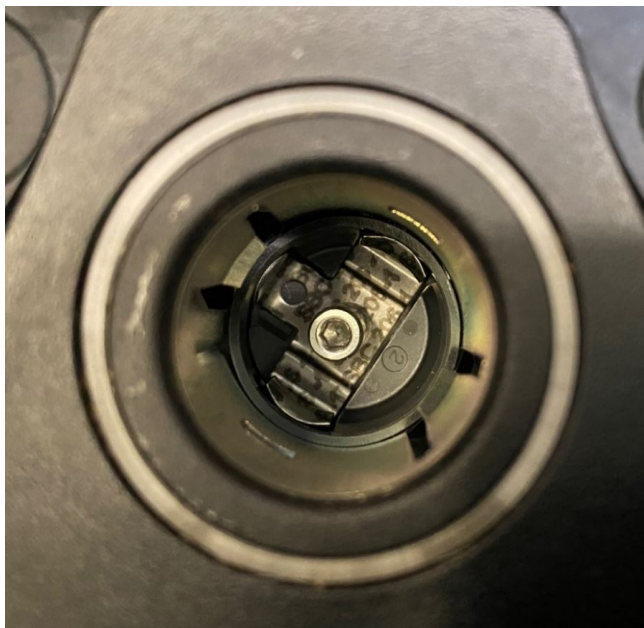

5. Using Special Tool 0496778, torque the bolt



to 1 NM.

6. Retest the customer's accessory.

7. Important: In order to verify the effectiveness of the repair, please submit an Info only case Title "SIB 61 01 20 performed" and provide feedback.

PARTS INFORMATION

Replacement bolt can be purchased from McMaster-Carr (industrial supply), item number 91292A112.

WARRANTY INFORMATION

This is not a warranty matter and is not covered under the vehicle warranty.

Powered by [Froala Editor](#)