



Technical Service Bulletin

Technical Service Bulletin: TSB200177	Released Date: 26-Aug-2020
Coolant Leaks – Exhaust Gas Recirculation (EGR) Cooler Coolant Supply and Return	

Coolant Leaks – Exhaust Gas Recirculation (EGR) Cooler Coolant Supply and Return

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- ISB 6.7 CM2350 B103
- ISB 6.7 CM2350 B142B
- B6.7 CM2350 B135B
- B6.7 CM2350 B148B

Issue

Symptom:

- Engine coolant leaking from the exhaust gas recirculation cooler coolant supply and return hoses, clamps, or interfaces.

Root Cause:

- Compression set of the rubber section of the exhaust gas recirculation coolant supply and return hoses, clamps, or interfaces causing a loss of clamp load from the associated hose clamps.

Verification

If a coolant leak is observed in the hose and /or the hard pipe, inspect the rubber section of each coolant hose for splits, cracks, hardening and other damage as per the service manual instruction.

Resolution

If no damage is observed, replace the existing clamp, Part Number 3010550, with the new clamp, Part Number 4930327.

Service Parts Availability

Service parts are available. See Table 1 for part numbers.

Table 1, Service Parts				
Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
Clamp, Hose	3010550	No	No	4930327

Document History

Date	Details
2020-8-25	Module Created

Last Modified: 26-Aug-2020
