

Front bumper/facia fit above headlamps

Topic number	LI88.20-P-071570
Version	1
Function group	88.20 Bumpers
Date	08-12-2020
Validity	BR290 with manufacturing date up to and including 07/2019
Reason for change	
Reason for block	

Complaint:

Bulging of front bumper/facia above headlamps (see attachment). Function of headlights not blocked or impaired.

Attachments	
File	Description
Beanstandung.JPG	Bulging on bumper above the headlamp

Cause:

Bonding between bracket and bumper may be separating.

Remedy:

Before carrying out the repair, create a PTSS case and include the following:

1. Pictures of the complaint
2. Information as to whether the brackets can be easily removed without damaging or deforming the bumper (little or no (remaining) bond) or whether the bond is (still) too strong.

Depending on the result of this check, proceed as follows:

- If brackets can be easily removed without damaging or deforming the bumper --> Reworking instructions will be provided via the PTSS case
- If brackets cannot be removed without damaging or deforming the bumper (bond too strong --> the entire bumper incl. brackets must be replaced)

In both scenarios, a PTSS case containing the necessary information must be created before carrying out any repairs or replacing parts.

If the production date of the vehicle is after July 2019, create a PTSS case.

Symptoms
Body / Bumper / Poor fit

XENTRY TIPS

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 290 885 05 01			Left bumper bracket	1		X
A 290 885 06 01			Right bumper bracket	1		X

Attachments

Beanstandung.JPG:

