



Technical Service Bulletin

90 Instrument cluster tire pressures are in metric (kPa) and cannot be changed

90 20 66 2060632/1 September 4, 2020.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
RS6, RSQ8	2020	All	TPMS

Condition

Customer states:

- The tire pressures in the instrument cluster are shown in metric (kPa).
- Changing the measurement units in the MMI settings menu has no effect.



Figure 1. Tire pressures shown in kPa.

Technical Background

A problem in the configuration of the instrument cluster during production causes the measurement unit setting to be inoperable and display the wrong units.

Production Solution

New Target Data Container (ZDC) update in the instrument cluster control module, J285 (address word 0017) addressed the condition.

Service

SVM Update Instructions

1. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions*.



Technical Service Bulletin

2. Update the instrument cluster control module, J285 (address word 0017) using the SVM action code as listed in the table below, if necessary:

Model	Old Target Data Container Number	Old Target Data Container Version	New Target Data Container Number (or higher)	New Target Data Container Version (or higher)	SVM Code Input
RS6	4K0909525G	*	4K0909525VG	0001	17A032
RSQ8	4M8909525F	*	4M8909525VF	0001	17A032

Warranty

Claim Type:	<ul style="list-style-type: none"> • 110 up to 48 Months/50,000 Miles. • G10 for CPO Covered Vehicles – Verify Owner. • If the vehicle is outside any warranty, this Technical Service Bulletin is informational only. 		
Service Number:	9025		
Damage Code:	0039		
Labor Operations:	Software Update (Includes checking for DTCs)	0151 0000	Time stated on the diagnostic protocol (Max 30 TU)
Diagnostic Time:	GFF	No allowance	0 TU
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
Claim Comment:	As per TSB #2060632/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

The following Technical Service Bulletin(s) will be necessary to complete this procedure:

- TSB 2011732, *00 Software Version Management (SVM), operating instructions.*



Technical Service Bulletin

All part and service references provided in this TSB (2060632) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2020 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.