



Service Bulletin


Bulletin No.: 20-NA-162

Date: August, 2020

INFORMATION

Subject: Information on Excessive Amounts of Dirt and Debris on Fuel Cap

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Silverado	2015	2018	-	-	L5P, LML	-
	Silverado 2500/3500	2019	2019				
GMC	Sierra	2015	2018				
	Sierra 2500/3500	2019	2019				

Involved Region or Country	North America	
Condition	 <div>5641096</div> <p>Some customers may comment that excessive amounts of dirt and debris is building up on the fuel cap.</p>	
Cause	Important: This repair is a customer pay alteration. All work and payment, authorization must come from the customer.	



5641708


This condition may be caused by excessive build up of dirt and debris on the fuel tank vent.



5641101

– Over time, this will plug and the venting of the tank will be through the fuel cap.


Correction

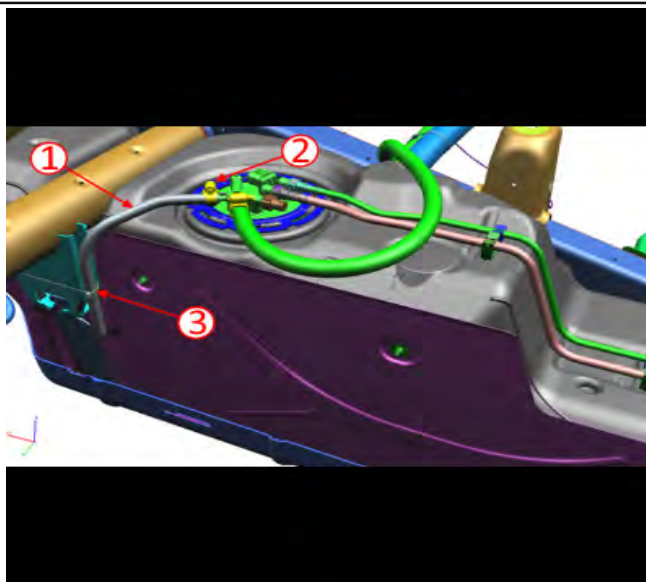

5641111


Note: Several different lengths of vent line will be needed to accommodate all the tank/frame options.

1. Install a fuel line hose (1) to the vent and route down the side of the fuel tank strap.
2. Install and hand tighten the hose clamp (2).
3. Utilizing a tie strap (3), secure the hose to the fuel tank support strap mount.

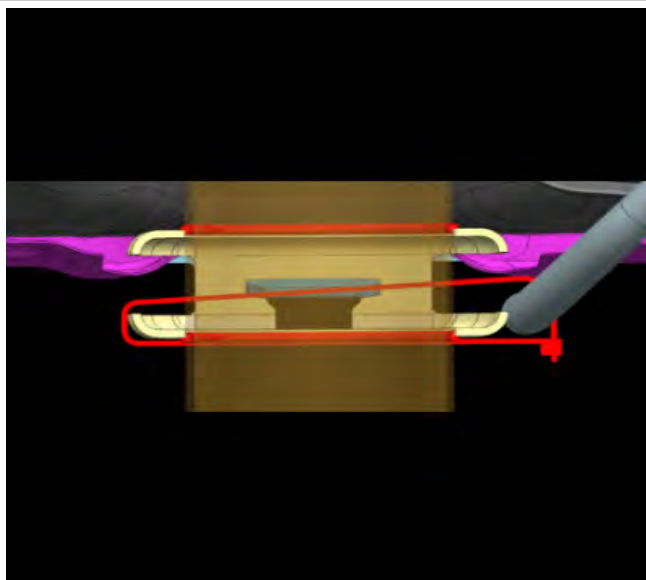

5641189

- Refer to graphic above for suggested tie strap route.

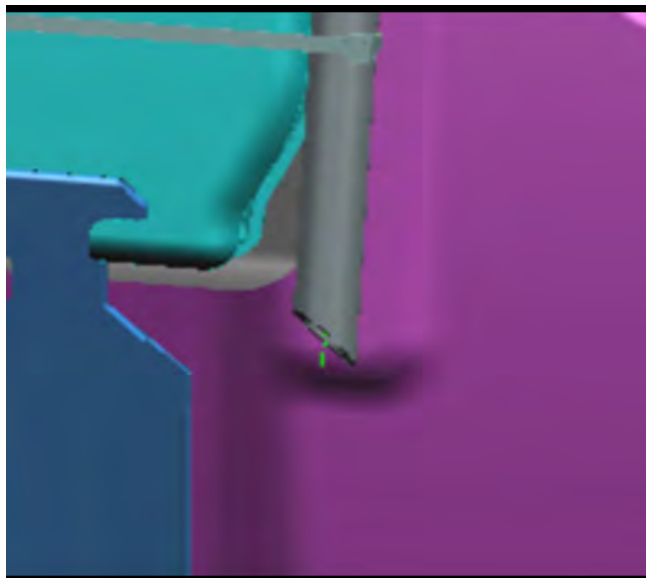

5641130

4. When the desired length is reached, the end of the vent hose should be cut at approximately at a 45 degree angle to assist with drainage and blockage prevention due to dust.

Note: Cut to be positioned such that it is pointed rearward in vehicle.

Parts Information

Lawson Products can be contacted by Phone: 866.837.9908 or on-line: <https://www.lawsonproducts.com/company-info/customer-service>

Causal Part	Description	Part Number	Qty
N/A	Clamp, HOSE	11609970	1
N/A	TIE STRAP	11509086	1
N/A	LAWSON FUEL LINE HOSE	*6637	(Length as required)

Version	1
Modified	Released August 17, 2020

