

**SSM 49185 - 2020 F-Super Duty, 2021 F-650/F-750 - 6.7L - Illuminated MIL  
With DTC P0088 - Built On 01-Mar-2020 And Through 31-Aug-2020**

Some 2020 F-Super Duty and 2021 F-650/F-750 vehicles equipped with a 6.7L diesel engine built on 01-Mar-2020 and through 31-Aug-2020 may exhibit an illuminated malfunction indicator light (MIL) with diagnostic trouble code (DTC) P0088. This may be due to the pressure control valve in the left fuel rail. To correct the condition, replace the left fuel rail along with the pressure control valve (PCV). For F-250 through F-550 vehicles refer to Workshop Manual (WSM), Section 303-04B. For F-650/F-750 vehicles refer to WSM, Section 303-04A. For claiming use causal part 9D280 and applicable labor operations in Section 09 of the Service Labor Time Standards (SLTS) Manual.

**APPLICABLE VEHICLES**

2021 TRUCK: BC H567N MEDIUM TRUCK  
2021 TRUCK: BC H567N MEDIUM TRUCK  
2021 TRUCK: BC H567N MEDIUM TRUCK  
2020 - 2021 TRUCK: FE P558N SUPER DUTY