

Symptom-based workshop manual

Service

142/20 ENU 4000

4

Noise Symptom - Rear Shock Absorber Rattling: Replacing Rubber Stops (SY 142/20)

Model Line: Macan (95B)

Model Year: As of 2019

Equipment: 4 corner air suspension with electrically regulated damping (I-no. 1BK)

Subject: Shock absorber

Symptom: Rattling noises can be heard from the rear axle area when driving on uneven surfaces, e.g. pot holes,

bumps, etc.

Cause: The noise is caused by the additional springs with dust boot that can slip out of the shock absorber

mounting when driving on roads with uneven surfaces.

Remedial In the event of a customer complaint, replace the rubber stop, see

Action:
⇒ Workshop Manual '429319 Removing and installing rear shock absorber'

⇒ Workshop Manual '429337 Disassembling and assembling rear shock absorber'

Parts required for one shock absorber

| Parts Info: | Part No. | Designation | Qty. |
|-------------|------------|---|-------|
| | | - Use | |
| | 95B512131G | \Rightarrow Rubber stop for air spring | 1 ea. |
| | | Vibration damper | |
| | N 10500802 | ⇒ Hex flange bolt, self-locking | 1 ea. |
| | | Vibration damper | |
| | N 91066101 | ⇒ Hexagon-head bolt (combination) | 2 ea. |
| | | Shock absorber mounting | |

Service 4000 ENU 142/20

Symptom-based workshop manual

Invoicing

Invoicing: For documentation and warranty invoicing, enter the labor operations, PQIS coding and part numbers

specified below in the warranty claim:

| APOS | Labor operation | I No. |
|----------|---|-------|
| 42931951 | Removing and installing rear shock absorber (left) | |
| 42931952 | Removing and installing rear shock absorber (right) | |

| APOS | Labor operation | I No. |
|----------|---|-------|
| 42931950 | Removing and installing rear shock absorbers (both) | |
| 43661951 | Removing and installing rear spring damper (left) | |
| 43661952 | Removing and installing rear spring damper (right) | |
| 43661950 | Removing and installing rear spring dampers (both) | |

PQIS coding:

| Location (FES5) | 4000Z | Chassis |
|-------------------|-------|----------|
| Damage type (SA4) | 2014 | Rattling |

| Parts Info: | Part No. | Designation - Use | Qty. |
|-------------|------------|---|-------|
| | 95B512131G | Rubber stop for air spring | 1 ea. |
| | | Vibration damper | |
| | N 10500802 | Hex flange bolt, self-locking | 1 ea. |
| | | Vibration damper | |
| | N 91066101 | Hexagon-head bolt (combination) | 2 ea. |
| | | Shock absorber mounting | |

References: ⇒ Workshop Manual '429319 Removing and installing rear shock absorber'

⇒ Workshop Manual '429337 Disassembling and assembling rear shock absorber'

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

Sep 18, 2020 Page 2 of 2