



69-20-01 - Airbag Control Module -J234- - DTC B201C00 (U.S. Only)

Release date: 9/21/2020

Condition

Applicable Vehicles						
Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To	PR Code
Tiguan	2020	All	All	AX_LM001867	AX_LM140225	#U3

Revision Table			
Instance Number	Published Date	Version Number	Reason For Update
2060228/1	9/21/20	69-20-01	Original publication.



Note:

Do Not perform this technical bulletin unless DTC B201C00 is stored in Airbag Control Module -J234-.

DTC	Description
B201C00	Supply Voltage Range/Performance

Technical Background

DTC stored in Airbag Control Module -**J234-** due to fuse SC49 not being removed after accessory kit for extended range remote start installed.

Production Solution

Not applicable.

Service

1. Connect scan tool and interrogate Airbag Control Module -**J234-**.
2. Verify the vehicle has PR Code #U3.
3. If DTC B201C00 is stored in the Airbag Control Module -**J234-**, remove fuse SC49 from fuse panel C (Figure 1).
4. Clear DTCs and road test.

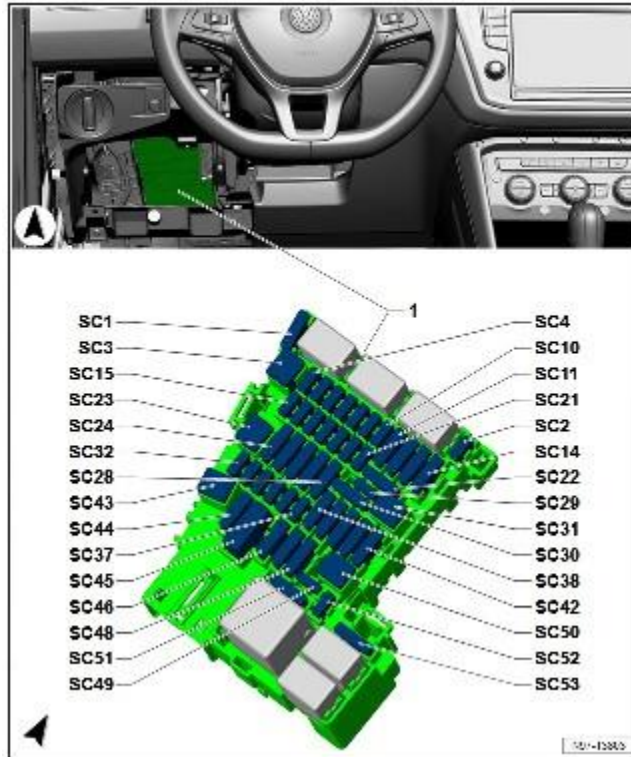


Figure 1: Fuse panel C.

Warranty

To determine if this procedure is covered under Warranty, always refer to the Warranty Policies and Procedures Manual ¹⁾

Model(s)	Year(s)	Eng. Code(s)	Trans. Code(s)	VIN Range From	VIN Range To
Tiguan	2020	All	All	AX_LM001867	AX_LM140225
SAGA Coding					
Claim Type:	Sold Vehicles: 1SP				
	Unsold Vehicles: 9SP				
Service Number:	Damage Code	HST	Damage Location (Depends on Service No.)		
2766	0040	--	Use applicable when		



69-20-01 - Airbag Control Module -J234- - DTC B201C00 (U.S. Only)

Release date: 9/21/2020

			indicated in Elsa (L/R)
Parts Manufacturer	Tiguan		444 ²⁾
Labor Operation ³⁾ : Battery Charge	27068950 = see Elsa for latest time units.		
Labor Operation ³⁾ : Remove Fuse SC49 (Inc. removal of central electrics cover)	97921900 = see Elsa for latest time units.		
Causal Part:	97921900 (no parts claim)		
Diagnostic Time ⁴⁾			
GFF Time expenditure	01500000 = 50 TU Max.	YES	
Road Test	01210004 = 10 TU	YES	
Technical Diagnosis	01320000 = 00 TU max.	NO	
Claim Comment: Input "As per Technical Bulletin 2060228" in comment section of Warranty Claim.			
¹⁾ Vehicle may be outside any Warranty in which case this Technical Bulletin is informational only. ²⁾ Code per warranty vendor code policy. ³⁾ Labor Time Units (TUs) are subject to change with ELSA updates. ⁴⁾ Documentation required per Warranty Policies and Procedures Manual.			

Required Parts and Tools

Tool Description	Tool No:
Midtronics Battery Tester/Charger	GRX3000VAS or MTRMSP0702 battery maintainer/charger
VAS Diagnostic Tool	VAS 6150/X & VAS 6160/X and - ODIS Service with: current online updates



69-20-01 - Airbag Control Module -J234- - DTC B201C00 (U.S. Only)

Release date: 9/21/2020

Additional Information

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.