



# Service Information

Offboard Diagnostic Information System Service (ODIS Service)

Number: VOS-20-33

Subject: Software Version Update, Enhancements and Fixes

Date: Sep. 25, 2020

**Supersedes VOS-20-28 due to new diagnostic content.**

The following ODIS Service software versions are available for download.

Current ODIS Service Software Versions	
Application: <b>V6.2.0</b>	Diagnostic Content: <b>V2.40.13</b>

**Key Fixes/Enhancements for Diagnostic Content: V2.40.13:**

## 1. CA/CM Atlas 2018 – 2020, BW - Tiguan 2018 – 2020, BU - Jetta 2018 – 2020

Basic setting Steering Angle Sensor - G85 and Software configuration

J500\_X\_1\_0512\_11\_Grundeinstellung\_G85\_00011 test malfunction.

- The data was not written. The following function could not be performed: Basic setting Steering Angle Sensor - G85 - Submit a technical query.

## 2. BW - Tiguan 2018 – 2020

P244000: Secondary Air Injection System Switching Valve Stuck Open Bank1

SYS\_X\_1\_0916\_11\_X\_X\_SLS\_FSB\_00000 did not perform any actuator test for the Secondary air injection pump motor (V101).

- Secondary air injection pump motor (V101) was malfunctioning.

## 3. Atlas, Tiguan, Jetta, Golf (All models)

Test checking fuel tank for leaks SYS\_X\_1\_0816\_11\_X\_X\_TDK\_FSB\_00000 basic setting malfunction.

- The function could not be performed. Send feedback to support.
- The function was not performed successfully. Open an incident ticket and attach the associated diagnostic log

## 4. AU - Golf 2013 – 2020 and CA/CM Atlas 2018 – 2020

Airbag read measured values test J234\_X\_0116\_1\_11\_ASAM\_MW\_lesen\_00000 when selected from GFF airbag functions or airbag GFs does not display any values.



# Service Information

---

## 5. 1K - Jetta 2005 – 2010

Select A/C measured values SYS87\_1K\_\_\_\_\_1\_0704\_66\_Messwerte\_lesen\_Climatronic\_00066 are not displaying any read values.

## 6. A3 - Passat/New Midsize Sedan 2011 – 2015, CKRA 2.0 L TDI-CR / 103 kW

Reset SCR error message SYS\_XX\_J623\_CFX\_1\_0610\_11\_SCR\_Fehlermeldung\_00011 malfunction.

- Particle filter service regeneration test says successful but the SCR error message is not reset.

## 7. 1K - Jetta 2005 – 2010, CJAA 2.0l TDI CR / 103 kW.

P1946: Radiator Fan Control Module 1 Faulty/open circuit in voltage supply

J293\_XXXXXX\_1\_0708\_11\_00011 malfunction.

- Malfunction! This test is not parameterized for this vehicle. The test must be canceled. Write a complaint report. - Perform fault finding using the wiring diagram. The test is canceled!

## 8. 16 - Jetta 2011 – 2018, CNLA 1.4l TFSI Hybrid / 110 kW

P057B00: Brake Pedal Position Sensor "A" Circuit Range/Performance

- G100\_X\_1\_1112\_11\_30TFS01\_X\_Bremspedalstellungsg\_00011 error occurred during control module communication.
- The value Brake\_pedal\_position\_relative\_value\_raw\_channel\_2 for the request parameter Record Data Identifier could not be entered.

## 9. General translation errors.