



GROUP  
Group

MODEL  
2018MY  
Rio (SC)

NUMBER  
PS671

DATE  
September 2020


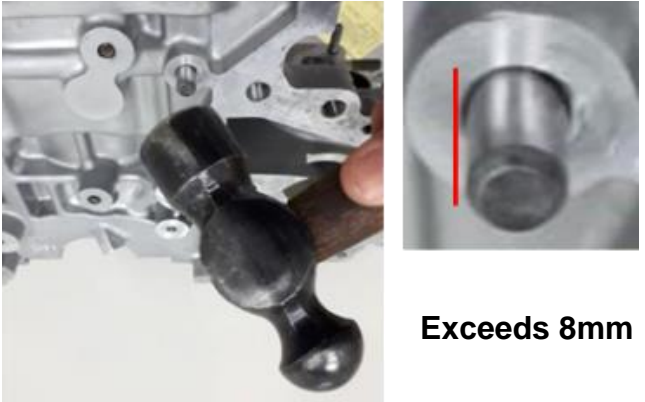


## TECHNICAL OPERATIONS

SUBJECT:

### POTENTIAL LOW OIL PRESSURE DUE TO DOWEL PIN NOT FULLY SEATED

This Pitstop provides information regarding a potential low oil pressure warning light 'ON' on some 2018MY Rio (SC) vehicles, produced from August 3, 2017 through November 6, 2018, which may be due to the oil pressure leaking past the timing tensioner chain dowel pin. If the dowel pin is not fully seated as described in this publication, measure and adjust the pin height as required between 7-8mm (pin length is 14mm).

Good	No Good
	 <p><b>Exceeds 8mm</b></p>
Measures 7-8mm. OK.	Measures 9mm>. Adjust as required.

**Note: If the dowel pin measures less than 6mm, replace the engine block due to incorrect drilling depth. Confirm proper authorizations prior to block replacement.**