ATTENTION:							
ATTENTION.	IMPORTANT - AII						
GENERAL MANAGER	Service Personnel						
PARTS MANAGER	Should Read and						
CLAIMS PERSONNEL	Initial in the boxes provided, right.						
SERVICE MANAGER	© 2020 Subaru of /	America	a. Inc. <i>P</i>	\II riahts	reserv	ed.	



SERVICE BULLETIN

APPLICABILITY: 2017-20MY Impreza

2018-20MY Crosstrek

2018-20MY Crosstrek Hybrid (PHEV)

SUBJECT: Intake Manifold / Tumble Generator Valve (TGV)-

Design Change

NUMBER: 09-72-20R

DATE: 07/31/20

REVISED: 09/11/20

INTRODUCTION:

This bulletin announces availability of new intake manifold assemblies. These new manifolds include enhanced TGV assemblies to address related DTCs which may set as a result of lubricant contained within the actuator component of the TGV leaking and being drawn into the engine. Over time, the TGV operation can become erratic and cause any of the following TGV related DTC(s) to set: P2004, P2005, P2006, P2007, P2009 and / or P2012. The internal sealing of the TGV actuator assembly has been optimized to eliminate lubricant leakage into the engine. Since the TGV component is not serviced separately, the intake manifold assembly must be replaced when a failure is confirmed.

PRODUCTION CHANGE INFORMATION:

The new Intake Manifold assemblies were incorporated into production as per the table below.

Model	Starting VIN		
Impreza 4-Door	L3612652		
Impreza 5-Door	L3728005		
Crosstrek	LH264200		
Crosstrek Hybrid	LH262309		

PART INFORMATION:

Description	Part Number	Application		
MANIFOLD COMPLETE- INTAKE	14001AC501	Crosstrek & Impreza		
IVIANIFULD GUIVIPLETE- INTAKE	14001AC631	Crosstrek Hybrid (PHEV)		

REMINDER: Always order the most up-to-date replacement parts based on the specific VIN being repaired.

CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.

Subaru of America, Inc. is ISO 14001 Compliant

ISO 14001 is the international standard for excellence in Environmental Management Systems. Please recycle or dispose of automotive products in a manner that is friendly to our environment and in accordance with all local, state and federal laws and regulations.

Continued...

SERVICE PROCEDURE / INFORMATION:

REMINDER: Customer satisfaction and retention starts with performing quality repairs.

The service procedures for Intake Manifold replacement remain unchanged. Always refer to the applicable Service Manual and review the full requirements of the repair being performed. The Service Manual procedures contain information critical to performing an effective repair the first time, every time. This includes but is not limited to, proper inspection criteria, necessary special tools, required processes and related one-time-use parts needed for a complete and lasting repair.

WARRANTY / CLAIM INFORMATION:

For vehicles within the Basic New Car Limited, Powertrain, an applicable Emission Warranty period or covered by an active Subaru Added Security Powertrain, Classic or Gold plan, this repair may be submitted using the following claim information:

Labor Description	Labor Operation #	Vehicle Model	Labor Time	Fail Code
OBDII TGV ACTUATOR, BOTH R&R	A455-534	Impreza	1.8	DCF-43
,		Crosstrek		
NOTE: Labor times include testing & diagnosis, Select Monitor use and test drive.		Crosstrek PHEV		

IMPORTANT REMINDERS:

- SOA strongly discourages the printing and/or local storage of service information as previously released information and electronic publications may be updated at any time.
- Always check for any open recalls or campaigns anytime a vehicle is in for servicing.
- Always refer to STIS for the latest service information before performing any repairs.

Bulletin Number: ; Date: 07/31/20 Page 2 of 2