

Document Information

This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.

Vehicles affected: P22 McLaren GT

Location: Electrical - Electrical Systems

Concern: Power Tailgate Warning Message when the vehicle is not equipped with one

Condition: When tailgate is operated

Diagnostic Trouble Codes

PTCU:

B2B2001

Hall Sensors Power Supply (HS3) - Open circuit

U108203

Powered Tailgate module not configured

Measure

It has been identified that a small number of vehicles have been fitted with a PTCU module when the vehicle was ordered without this option. This will result in a warning message in the vehicle's IC when the tailgate button inside the cabin of the vehicle is pressed.



Please confirm that the vehicle was ordered without a power tailgate. If that is the case, to address this issue the technician is required to unplug and physically remove the PTCU module from the vehicle. The removal of the module is necessary for avoiding unintended re-connection of the module if any future work is carried out in that area.

Parts Information

N/A

Warranty Information

Resolution Code to use for the Warranty Claim is found below, the total time that can be claimed for the above repair is 0.70 Hours - FA-RM-09M002-19-001 - Remove/Install Control unit - Tailgate. For any additional time, ensure the breakdown of the time and explanation is recorded in the Work Package.

Location:

Function Group:

Sub Group:

Part:

Fault Group:

Fault Code:

Cause:

Rectification:

Attachments

N/A

MTI Updates Information

N/A

This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.