

Document Information

This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.

Vehicles affected: P15R: Senna GTR

Location: Body Exterior

Concern: Air jacks leaking

Condition: When deployed

Diagnostic Trouble Codes

N/A

Measure


McLaren have identified a potential fault with the McLaren Senna GTR air jack system. As the car is raised on the jacks, the car slowly sinks at the front, rear, individual corners or at all points depending on the component assembly. We therefore request that at the next service booking or track event, all banjo bolts need to be checked for the correct application of copper grease and correct tightening torque.

Correct torque setting:

Banjo bolt: 15CA140RP M14x1.5 @ 35NM

Correct copper grease application:

Only apply copper grease on the thread of the bolt

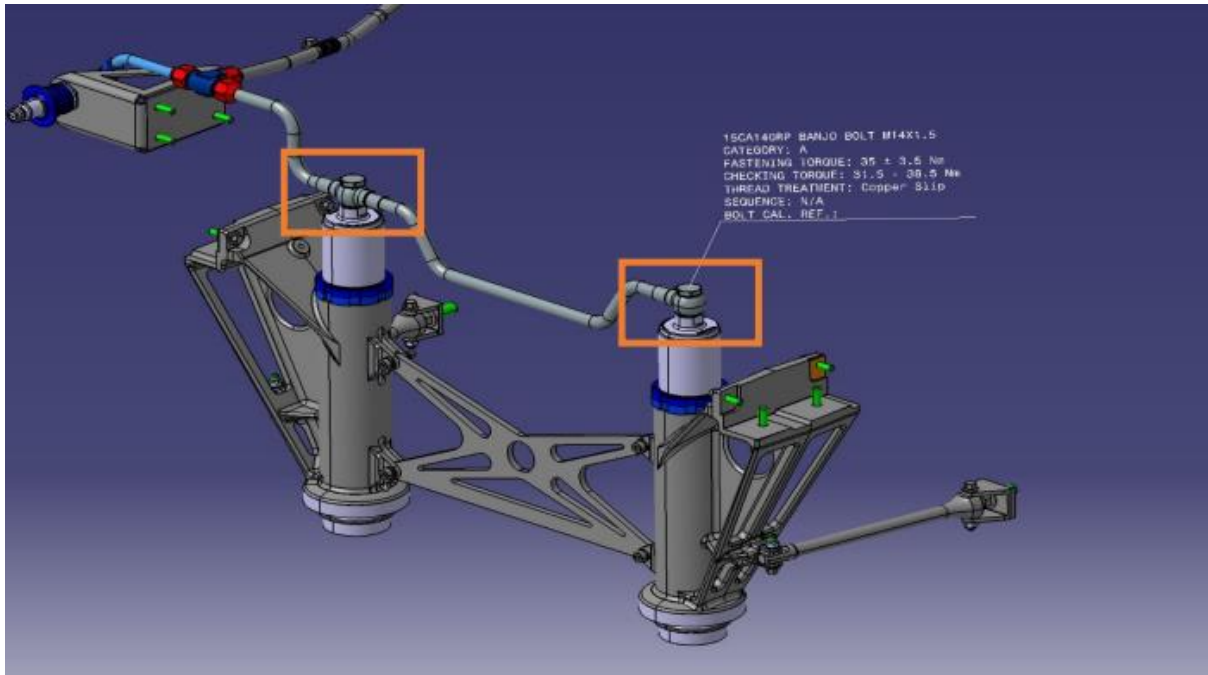

MTI Updates Information

N/A

This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.