

TECHNICAL TOPICS ELECTRICAL



L551 Flickering Screen

20MY RR Evoque

Customer Voice:

- Upper and/or Lower screen behaves erratically: glitching, flickering, or scrolling.

Technical Description:

- A software calibration change was released in 20B1, some vehicles continue to exhibit erratic behavior.

Status:

- For any issues that are discovered post 20B1 please submit a TA or EPQR with photos of the failure mode and the IMC is already at 20B1.
- Affected vehicles will need a TA raised first.
- Replace the APIX cable with L560 cable and a CCF change to match new cable length.
- It is extremely important that we document the repair in a TA to prevent future repairs reverting the APIX cable back to a L551 cable until the SSM/TSB is released.

