

## Document Information

This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.

Vehicles affected: P15; Senna GTR

Location: Electrical - Instrument Cluster

Concern: Odometer increasing by itself

Condition: With wheel speed sensor disconnected

## Diagnostic Trouble Codes

N/A

## Measure

Due to the use of a Motec Instrument Cluster, if a wheel speed sensor is left disconnected and the ignition turned on, the mileage will start to increase at a rate of 600 Kph's. Should an unexpected mileage increase be identified, first check for wheel speed sensor disconnection or wiring damage. **Ensure ignition is not unnecessarily left turned ON.**

There is no way to reset the mileage, as a result it may be necessary to replace the Motec IC and SBC should this fault occur.

If you experience this issue, please submit a Technical Request for support.

## MTI Updates Information

N/A

This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.