

## Document Information

This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.

Vehicles affected: McLaren Speedtail

Location: N/A

**Concern:** Please read below some of known limitations of the existing software level 4.3. All of these topics are currently under investigation and where possible countermeasures will be included in the next software platform release (expected June 2020). If you have any specific questions please raise them via a Technical Request.

**Condition:** Permanent

## Diagnostic Trouble Codes

N/A

## Measure

### User Interface

- During oil level check the engine speed limiter is not fixed to 2000 rpm but it is oscillating. Due to this, a misfire DTC may log in the ECM. Clear the DTC and no further action is required
- "Battery critically low" message may be displayed on the IC during wake-up even though battery voltage is good
- Velocity mode: if you press many times on Home button, the ADI goes out from velocity animation to home screen
- English is the only supported language

### Infotainment System

- USB port: Currently is not available, pending certification approval
- Radio: AM/FM radio functionality is not available
- Phone: Signal bar displayed is one less than displayed on the phone

- Bluetooth Media: In Playlist, the current playing music is not present (it is from browse all songs)
- Bluetooth Media: Repeat and shuffle are not operating from ADI but are available from the phone device
- Bluetooth Media: Impossible to answer incoming calls through WhatsApp from the displays (only the red phone button is displayed not the green one when receiving the incoming call notification)

## Suspension

- "Suspension Failure" warning may appear if driving at 45 Kph on U-shape input

## Pre-Delivery Inspection (PDI) Key Points

- Some of the accessories will not be in the sealed bag
  - - Warning triangle and towing eye are located under the false floor of the rear luggage bin
    - The fire extinguisher, first aid kit and tyre inflation kit are located in the front luggage bin behind removable panel
    - The titanium tool kit and customer owner's manual will be delivered separately along with the wireless charger
- The wireless charger needs to be set up in the workshop during PDI before first use. Follow the instructions supplied with the charger, update the application before use
- Ensure the vehicle is not in lift when checking the Power Steering fluid level
- When setting the time and date use the GPS sync and then select the correct time zone
- Valet Pin is already set 0000 so no need to adjust this
- Check the function of all the electro chromatic glass zone using the Ambience Menu
- Ignore item "Preset local radio stations and check operation of all speakers" on the PDI sheet as radio is not available

## Parts Information

N/A

## MTI Updates Information

N/A

This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.