

Document Information

Location: Powertrain Systems - HVAC

Topic: Water ingress into the passenger or driver foot area

Condition: Mainly when HVAC system is in operation

Diagnostic Trouble Codes: N/A

Measure

If KA-01205 has already been worked through and the drain tube is found to be removed, and yet there is water ingress into the cabin floor, the position of the electrical body wiring harness running beneath the HVAC drain must be inspected.

If it is found to be blocking the HVAC drain, the water may be redirected into the vehicle's cabin.

Re-position the electrical body wiring harness to allow the water to freely flow from the HVAC drain and re-secure the electrical body wiring harness.

Refer to Attachments section of this article for images of the area.

Parts Information

N/A

Warranty Information

Resolution Category

Casual Part Number: N/A

Casual Part Name: N/A

Casual Issue: N/A

Rectification: N/A

Time: N/A

Attachments

Attached

Figure 1: HVAC Drain Tube Still

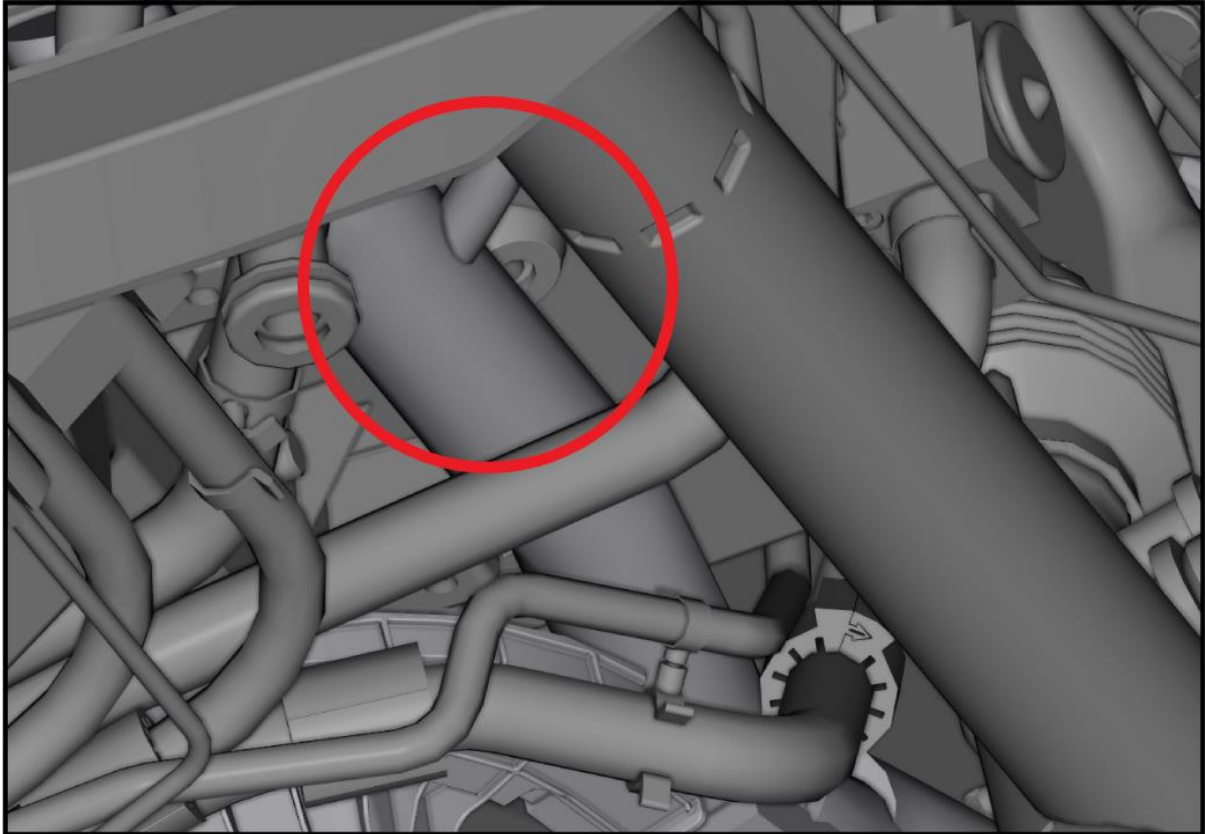


Figure 2: Body Harness Blocking

HVAC Drain

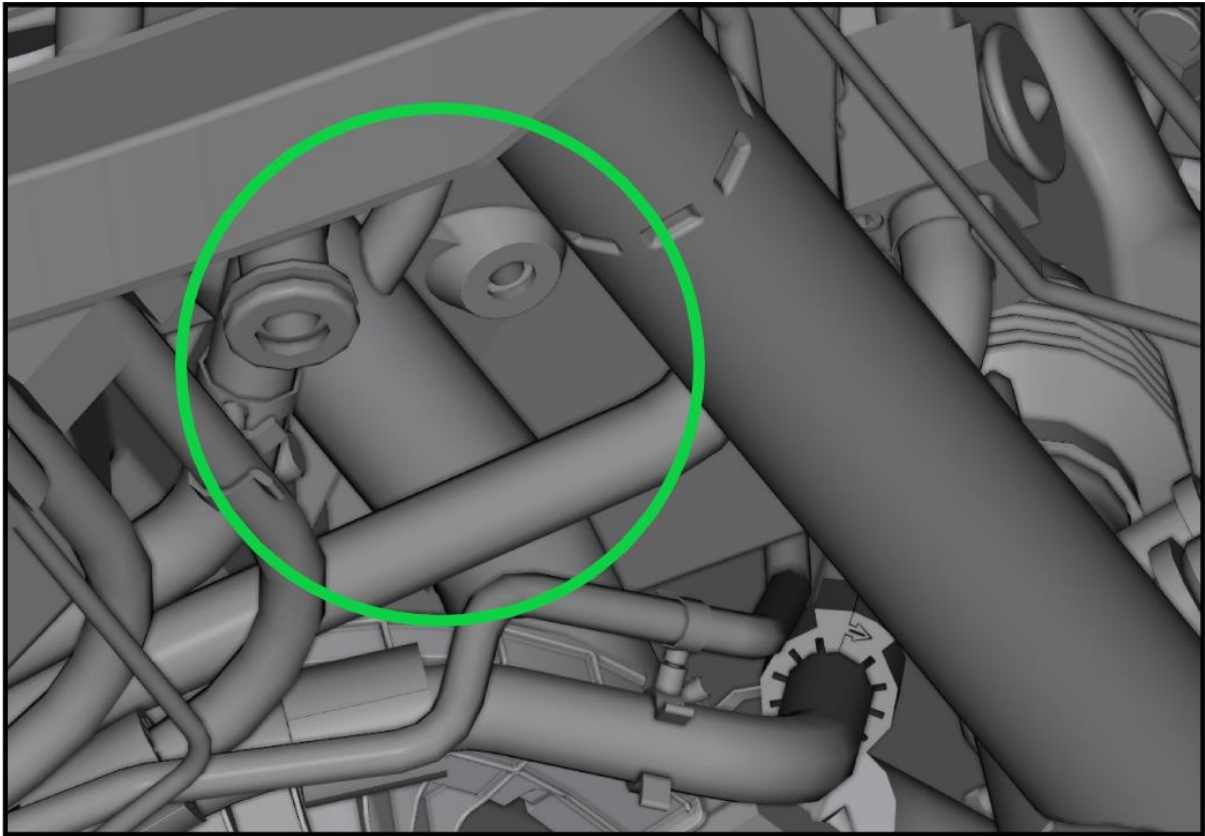


Figure 3: Body Harness Away

From HVAC Drain

KA Updates Information

N/A

This document is uncontrolled when printed. Before use, check the Knowledge Base within the McLaren Retailer Portal to verify that this is the current version.