

TECHNICAL TOPICS

BODY/CHASSIS



Front Door Window Operation

20MY Range Rover

Customer Voice:

- A customer may report the front door window is off track.

Technical Description:

- A limited number of vehicles may have been built with the front door window glass not properly installed into the locking clips in the window regulator.

Status:

- The concern has been addressed in production.
- For any unsold vehicle built before LG-594956 please check the window operation at PDI.
- Position the window halfway down and try to pull the glass upward by hand near the rear of the door. If the glass lifts it is not locked into the window regulator properly, please ensure that the glass is clipped in properly by first sliding it rearward into the rear window run seal and then downward into the regulator.

