

McLaren Senna – Left Engine High Temperature Radiator (HTR) Fan Wiring Harness Rework

Bulletin type:	Service Campaign
Reference number:	SCB 15 M 002
Attention:	Retailer Service Managers and Retailer Technicians
Affected vehicles:	McLaren Senna
Situation:	Potential for the Left HTR wiring harness to become loose from fixing points
Procedure:	To action affected vehicles during next Retailer visit. Please refer to the information outlined in this document to ensure the wiring harness is secure in its fixing points
Date:	6 th February 2020

This Service Campaign Bulletin will cover:

1. Overview
2. Procedure
3. Parts Information
4. Warranty Information
5. Affected Vehicles


1. Overview

Through continuous product quality monitoring, it has been identified that a number of McLaren Senna vehicles may experience a concern where the Left Engine High Temperature Radiator (HTR) fan wiring harness becomes loose from its fixing points. This could cause damage to the components; therefore, a preventive rework solution has been released.

2. Procedure

To carry out the required rework, the following steps are required:

Document SCB 15 M 002 WI (attached with this Bulletin) contains the relevant work instructions and care points to ensure the repair is carried out correctly, bringing the vehicle up to the current manufacturing standard.

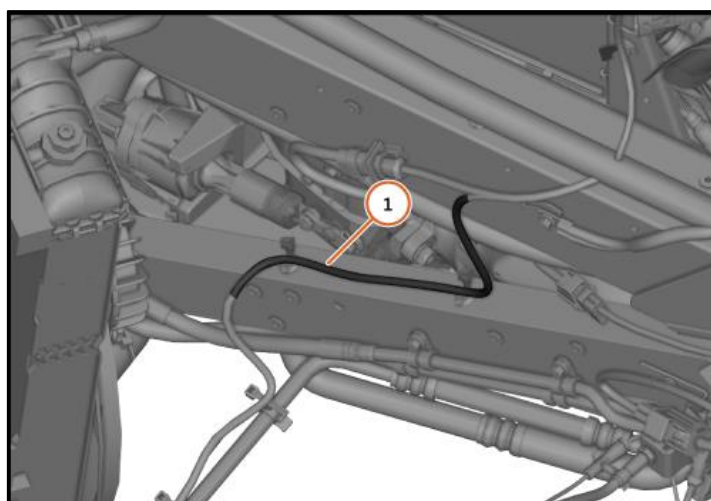

Layout overview - Left HTR wiring location for required rework (1)
(extract from SCB 15 M 002 WI)

3. Parts Information

The parts below are required to action this repair, which can be ordered via Unipart.

Part Number	Part Description	Quantity Required
15MA677CP	Kit Assy P15 LH HTR Fan Wiring	1

This kit contains the following:

Part Number	Part Description	Quantity Required
15CA241CP	Circlip	4
00RB185 - Included in kit	Clip	4
00RL043	High Temperature Fir Tree Cable Tie (Grey)	2
14CA128CP	High Temperature Sleeve (Silver)	2
00RL023	Cable Tie - High Temperature Grade (Brown)	1

4. Warranty Information

Submit a claim to the McLaren Warranty department following completion of the work using the following details.

Description	Repair Time
Left Engine High Temperature Radiator (HTR) Fan Wiring Harness Rework	2.15 hours

5. Affected Vehicles

Your Regional Aftersales Manager will contact you with a list of affected vehicles.

If you have any questions, please speak to your Regional Aftersales Manager.

Best regards,

The information contained in McLaren bulletins is for internal use only by McLaren Authorised Retailers and must not be published on external websites or social media forums etc.

Part numbers listed in McLaren bulletins are for reference only. Always check with the parts department to verify the latest part numbers.

All bulletins (Information/Campaign/Recall) issued by McLaren Automotive Limited ("McLaren") are intended only for use by technicians who have attended McLaren technical training courses. McLaren trained technicians have the equipment, tools, safety instructions and the know how to perform the job properly and safely. McLaren bulletins are written to inform McLaren technicians of conditions that may occur on some McLaren vehicles, or to provide information that could assist diagnosing a McLaren vehicle. Part numbers listed in McLaren bulletins are for reference only. Always check with the parts department to verify the latest part numbers.