



Bulletin No.: PIP5753
Published date: 09/30/2020

Preliminary Information

PIP5753 Lack Of Engine Performance and/or DTCs P003A, P0046, P0299 and/or P0234 May Set

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado	2020 - 2021	All	All	LM2	All
GMC	Sierra	2020 - 2021	All	All	LM2	All

Involved Region or Country	North America
Condition	A customer may have a concern with lack of engine performance and/or DTCs P003A, P0046, P0299 and/or P0234 may set.
Cause	These conditions may be caused by loose bolts on the turbocharger actuator, as indicated in the pictures below.





Correction:

If any of the three actuators bolt are not fully seated, replace the turbocharger. If all the bolts are fully seated, this PI does not apply. Continue with normal Service Information diagnostics.

Warranty Information

For vehicles repaired under the Emissions (E) coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4087588	Turbocharger replacement	Straight time
*This is a unique Labor Operation for Bulletin use only.		

Version History

Version	1
Modified	09/30/2020 - Created on



© 2020 General Motors. All Rights Reserved.