



**NUMBER:** 18-082-20

**GROUP:** 18 - Vehicle Performance

**DATE:** September 11, 2020

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.*

**SUBJECT:**

Flash: Powertrain Control Module (PCM) Updates

**OVERVIEW:**

This bulletin involves reprogramming the PCM with the latest available software.

**MODELS:**

2020 (LD) Dodge Charger

**NOTE:** This bulletin applies to vehicles within the following markets/countries: North America, APAC, EMEA and LATAM.

**NOTE:** This bulletin applies to vehicles built on or before July 28, 2020 (MDH 0728XX), equipped with 3.6L V6 24V VVT Engine (Sales Code ERB).

**SYMPTOM/CONDITION:**

Customers may experience a Malfunction Indicator Lamp (MIL) illumination. Upon further investigation the technician may find following Diagnostic Trouble Code (DTC):

- P04FC - Crankcase Ventilation System Performance

Customer may also experience the following:

- Unable to set the cruise control above 132 km/h (82 mph).
- A hard brake pedal at higher altitudes.

Software enhancements also includes the following:

- Improved brake pedal feel at higher altitude.
- Cruise control enhancement.

**DIAGNOSIS:**

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available in DealerCONNECT/Service Library, verify all related systems are functioning as designed. If Symptom/Conditions, other than the one listed above are present, record the issues on the repair order and repair as necessary before proceeding further with this bulletin.

If the customer describes the symptom/condition listed above or if the technician finds the DTC, perform the Repair Procedure.

**REPAIR PROCEDURE:**

**NOTE: Install a battery charger to ensure battery voltage does not drop below 13.2 volts. Do not allow the charging voltage to climb above 13.5 volts during the flash process.**

**NOTE: If this flash process is interrupted/aborted, the flash should be restarted.**

1. Reprogram the PCM with the latest software. Detailed instructions for flashing control modules using the wiTECH Diagnostic Application are available by selecting the application's "HELP" tab.
2. Clear any DTCs that may have been set in any modules due to reprogramming. The wiTECH application will automatically present all DTCs after the flash and allow them to be cleared.

**POLICY:**

Reimbursable within the provisions of the warranty.

**TIME ALLOWANCE:**

| Labor Operation No: | Description   | Skill Category                    | Amount   |
|---------------------|---|-----------------------------------|----------|
| 18-19-06-D1         | Module, Powertrain Control (PCM)<br>- Reprogram<br>(0 - Introduction) | 1 - Engine Repair and Performance | 0.3 Hrs. |

**NOTE: The expected completion time for the flash download portion of this procedure is approximately 5 minutes. Actual flash download times may be affected by vehicle connection and network capabilities.**

**FAILURE CODE:**

**The dealer must use failure code CC with this Service Bulletin.**

- If the customer's concern matches the SYMPTOM/CONDITION identified in the Service Bulletin, failure code CC is to be used.
- When utilizing this failure code, the 3C's (customer's concern, cause and correction) must be provided for processing Service Bulletin flash/reprogramming conditions.

|    |                  |
|----|------------------|
| CC | Customer Concern |
|----|------------------|