



Service Bulletin

Bulletin No.: 16-NA-289

Date: September, 2020

TECHNICAL

Subject: Front Seat Back Cover Material Pulling Loose Around Easy Entry Release Handle

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Camaro	2016	2021	—	—	All	All

Involved Region or Country	North America, Europe, Russia, Middle East, Israel, Argentina, Brazil, Bolivia, Chile, Colombia, Paraguay, Uruguay, Japan, GM Korea Company, China
Condition	 <p style="text-align: right;">4581014</p> <p>Some customers may comment that the cover material on the driver or passenger seat back is pulling loose around the easy entry release handle bezel. Examples of a cloth and leather seat cover are shown in the graphic above.</p>
Cause	The cause of the condition may be that the cover material is currently not secured underneath the handle.

Correction

Install a screw (referenced in the Parts Information below) to secure the cover material to the underside plastic retainer following the Service Procedure below.

Service Procedure



4571158

Note: Graphics of this repair show the driver seat. Passenger seat would be similar.

1. Carefully remove the front seat back latch release handle bezel (1) on the affected seat. Refer to *Front Seat Back Latch Release Handle Bezel Replacement* in SI.



4581015

2. Reposition the seat cover material to align with the edge of the plastic retainer (1).



4581017

3. Mark a location on the material approximately 5 mm (1) from the inboard edge of the plastic retainer, and in-line with the existing hole in the handle base.



4581018

4. Using a 4.0 mm hole punch, punch a hole through BOTH the cover material and the plastic retainer (1).



5169853

5. Install the screw (1) securing the cover material to the plastic retainer.



5169856

6. Then, pulling the material and retainer farther upward, install the screw (1) in the existing hole of the handle base.



4581021

Parts Information

Description	Part Number	Qty
BOLT/SCREW-POA SERVICE PART ONLY	11547534	1

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
7080358*	Add Retainer to Secure Seat Back Material	0.3 hr

*This is a unique Labor Operation for bulletin use only.

7. Reinstall the front seat back latch release handle bezel. Refer to *Front Seat Back Latch Release Handle Bezel Replacement* in SI.
8. With the bezel reinstalled, squeeze the outboard, upper seat cushion to ensure the containment is robust.

Version	3
Modified	Released September 9, 2016 November 21, 2018 – Added the 2018-2019 Model Years, updated the retainer part number and graphics and changed the Warranty statement. September 23, 2020 – Added the 2020 and 2021 Model Years, updated the Involved Region or Country section and corrected the Labor Operation Description.

