



Service Bulletin


Bulletin No.: 19-NA-157

Date: October, 2020

INFORMATION

Subject: Brake Fluid Leak at Caliper, Cracking, Reduced Brake Performance, Rub or Grind Noise, Caliper Paint Appearance

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Camaro	2016	2021	—	—	All	All

Involved Region or Country	North America, South America, China, Japan, Russia, GM Korea Company, Middle East, Europe, Thailand, Israel
Condition	Some customers may comment on noise when braking, faded paint appearance on the calipers or brake fluid leaking from the calipers.
Cause	 <p>5338372</p> <p>Note: For vehicles that are frequently used for track events, changing the caliper boots should be part of maintaining the vehicle.</p> <p>The cause of the condition may be the caliper boots are heat checked/cracked, allowing brake fluid to leak. Heat checking will occur when the caliper has been exposed to intense heat created while braking. An example of this damage is shown in the graphic above.</p>
Correction	<p>Important: Caliper boot kits are available through CCA service parts and should be used to service the calipers. DO NOT replace calipers for this concern.</p> <p>Inspect the caliper boots for cracking, and replace as necessary. Refer to the appropriate <i>Front or Rear Brake Caliper Overhaul</i> in SI.</p>

Parts Information

Use the vehicle identification number (VIN), SI, and the GM Electronic Parts Catalog to determine the proper part to order.

Causal Part	Description	Part Number	Qty
N/A	Frt Brk Caliper - Dust Boot (RPO J6G)	13579455	2
	Frt Brk Caliper - Dust Boot (RPO J6H J6M)	19207044	
	RR Caliper Dust Boot (RPO J6G J6M)	22968937	
	RR Brake Caliper Dust Boot (RPO J6H)	89047739	

Version	2
Modified	Released July 9, 2019 September 30, 2020 – Added the 2020 and 2021 Model Years.

