 


Service

Category Brake

Section Brake (front) Market USA



Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2018 - 2020	Camry, Camry HV	

REVISION NOTICE

September 01, 2020 Rev1:

• The Applicability and Production Change Information sections have been updated.

Any previous printed versions of this bulletin should be discarded.

Introduction

Some 2018 – 2020 model year Camry and Camry Hybrid vehicles may exhibit a brake squeal/squeak noise from the front brake components.

For customers who find these characteristics objectionable, an updated brake caliper assembly and fitting kit is now available as a service part. Follow the Repair Procedures in this bulletin to address this condition.

Production Change Information

This bulletin applies to vehicles produced **BEFORE** and **AFTER** the Production Change Effective VINs shown below.

- For 2018 model year vehicles produced **BEFORE** the Production Change Effective VINs shown below perform Repair Procedure A.
- For 2018 model year vehicles produced AFTER the Production Change Effective VINs shown below perform Repair Procedure B.
- For ALL 2019 2020 model year vehicles perform Repair Procedure B.

NOTE

If the first three digits of the VIN begin with 4T1 and the 12th digit of the VIN is between 0 and 4, reference the table below.

MODEL	GRADE	ENGINE	PRODUCTION CHANGE EFFECTIVE VIN
	L, LE, SE, XLE	4 Cvl	4T1B11HK#JU144761
	XSE	4 Cyl.	4T1B61HK#JU144761
Camry	LE	HV	4T1B31HK#JU004476
	SE, XLE		4T1B21HK#JU009132
	XLE, XSE	6 Cyl.	4T1BZ1HK#JU020370

NOTE

If the first three digits of the VIN begin with 4T1 and the 12th digit of the VIN is between 5 and 9, reference the table below.

MODEL	GRADE	ENGINE	PRODUCTION CHANGE EFFECTIVE VIN
	L, LE, SE, XLE	4 Cvl	4T1B11HK#JU662207
	XSE 4 Cyl.	4 Cyl.	4T1B61HK#JU662207
Camry	LE LIV	LIV	4T1B31HK#JU507718
	SE, XLE	HV	4T1B21HK#JU510071
	XLE, XSE	6 Cyl.	4T1BZ1HK#JU506701

NOTE

- If the first three digits of the VIN begin with JTN, reference the table below.
- Repair Procedure B does NOT apply to Japan-built vehicles.

MODEL	GRADE	ENGINE	PRODUCTION CHANGE EFFECTIVE VIN	
C a	LE	4 C. J	JTNB11HK#J3071474	
Camry	SE	4 Cyl.	JTNB11HK#J3071473	



Warranty Information

Repair Procedure A

OP CODE	DESCRIPTION	MODEL	TIME	OFP	T1	T2
472404	D. P. D. Front Broke Coliners	Camry	1.1	47750-06320		
4/3101	473101 R & R Front Brake Calipers	Camry HV	1.2	47730-06320 47750-33380	36	99
Combo A	Opposite Side	All	0.2	47730-33380		

^{*}Both sides are to be replaced under this Service Bulletin.

Repair Procedure B

OP CODE	DESCRIPTION	MODEL	TIME	OFP	T1	T2
BR1914	R & R Front Shim Kit	Camry	0.7	04465-0E060	36	99
BR1915	(Both Sides)	Camry HV	0.7	04400-0000	30	99

APPLICABLE WARRANTY

- This repair is covered under the Toyota Basic Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

Parts Information

Repair Procedure A

NOTE

For North America Produced Vehicle (4T1), order both fitting kit part numbers listed.

WMI	PART NUMBER		PART NAME	QTY
VVIVII	PREVIOUS	NEW	PART NAIME	Q I I
	47750-06320	47750-06320 47750-06321 Cylinder Assy, LH		1
	47730-06320	47730-06321	Cylinder Assy, RH	1
4T1	04947-0E030 04947-0E031		Fitting Kit, Disc, Front	1
411	04947-06130		Fitting Kit, Disc, Front	1
	47389-50021		Brake Hose Gaskets	2
	00475-1	13F03	Brake Fluid	1



Parts Information (continued)

Repair Procedure A (continued)

wмı	PART NUMBER		DARTNAME	ОТУ
	PREVIOUS	NEW	PART NAME	QTY
	47750-33380 47		Cylinder Assy, LH	1
	47730-33380 47730-33381		Cylinder Assy, RH	1
JTN	04947-33280	04947-33281	Fitting Kit, Disc, Front	1
	47389-50021		Brake Hose Gaskets	2
	00475-13F03		Brake Fluid	1

Repair Procedure B

WMI	PART NUMBER	PART NAME	QTY	
4T1	04947-06130	Fitting Kit, Disc, Front	1	
JTN	Repair Procedure B Does Not Apply to Japan-built Vehicles			

Required Tools & Equipment

REQUIRED EQUIPMENT	SUPPLIER	PART NUMBER	QTY
Techstream ADVi*		TSADVUNIT	
Techstream 2.0	ADE	TS2UNIT	1
Techstream Lite	ADE	TSLITEPDLR01	1
Techstream Lite (Green Cable)		TSLP2DLR01	

^{*}Essential SST.

NOTE

- Only ONE of the Techstream units listed above is required.
- Software version 15.00.028 or later is required.
- Additional Techstream units may be ordered by calling Approved Dealer Equipment (ADE) at 1-800-368-6787.

T-SB-0015-20

Required Tools & Equipment (continued)

REQUIRED EQUIPMENT	SUPPLIER	PART NUMBER	QTY
ChassisEAR™ (or equivalent)	ADE	<u>JSP06608</u> (JS Products)	1

NOTE

- A mechanic's stethoscope or similar tool may be used in place of ChassisEAR™.
- ChassisEAR™ may be ordered by calling Approved Dealer Equipment (ADE) at 1-800-368-6787.

Repair Procedure A

1. Confirm the condition exists.

NOTE

- Brake squeal may be more likely at slower speeds.
- If necessary, use ChassisEar™ (or equivalent) to help identify the source of the noise.

Does the vehicle exhibit a squeal/squeak noise from the front brake components?

- YES Continue to step 2.
- NO This bulletin does NOT apply. Continue diagnosis using the applicable Repair Manual.
- 2. Replace BOTH front brake caliper assemblies.
 - A. Remove the front brake caliper assemblies.

Refer to TIS, applicable model and model year Repair Manual:

- 2018 2020 Camry:
 - Brake Brake (Front) "Brake (Front): Front Brake: Removal"
- 2018 2020 Camry HV:
 - Brake Brake (Front) "Brake (Front): Front Brake: Removal"
- B. Install the UPDATED front brake caliper assemblies.

Refer to TIS, applicable model and model year Repair Manual:

- 2018 2020 Camry:
 - Brake Brake (Front) "Brake (Front): Front Brake: Installation"
- 2018 2020 Camry HV:
 - Brake Brake (Front) "Brake (Front): Front Brake: Installation"

NOTE

Use Repair Procedure B when installing fitting kit (the two separate fitting kits) for North America Produced Vehicle (4T1).

3. Confirm the squeal/squeak noise is no longer present.

Repair Procedure B

1. Confirm the condition exists.

NOTE

- Brake squeal may be more likely at slower speeds.
- If necessary, use ChassisEar™ (or equivalent) to help identify the source of the noise.


Does the vehicle exhibit a squeal/squeak noise from the front brake components?

- YES Continue to step 2.
- NO This bulletin does NOT apply. Continue diagnosis using the applicable Repair Manual.
- 2. Replace BOTH front brake fitting kit assemblies (outer side ONLY).
 - A. Remove front brake pads.

Refer to TIS, applicable model and model year Repair Manual:

- 2018 2020 Camry:
 General Maintenance "Maintenance: Front Disc Brake Pad: Removal"
- B. Remove the outer side fitting kit assembly ONLY.

Figure 1.

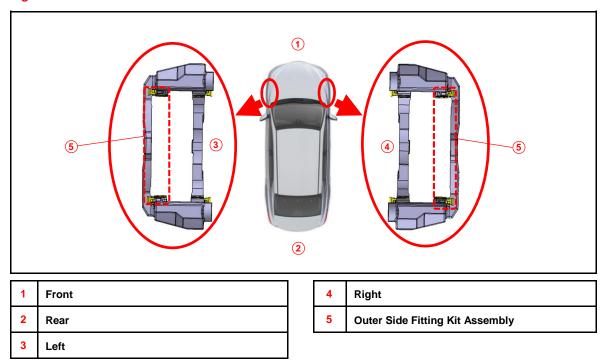




Repair Procedure B (continued)

C. Remove the four pieces from the fitting kit (P/N 04947-06130) and apply the Wako grease that is included in the kit.

Figure 2.

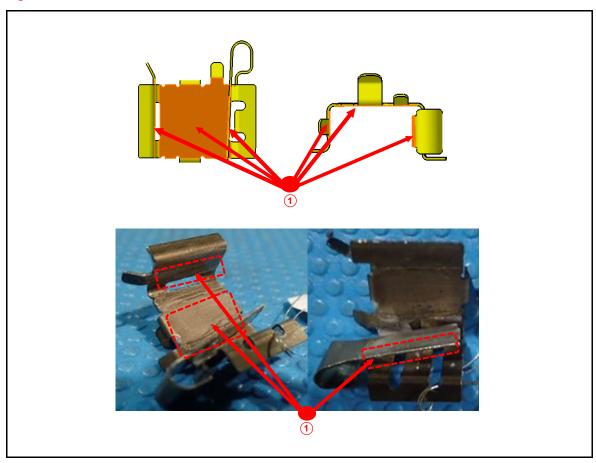

1 Grease Location

NOTE

Grease is to stay ONLY within the pad clip on specified areas (total Wako grease quantity: 0.0075g).




Repair Procedure B (continued)

D. Install the four fitting kit pieces with Wako grease applied onto the outer side of the caliper brackets.

Use the original fitting kit for the inner side of the bracket (P/N 04947-0E031).

Figure 3.

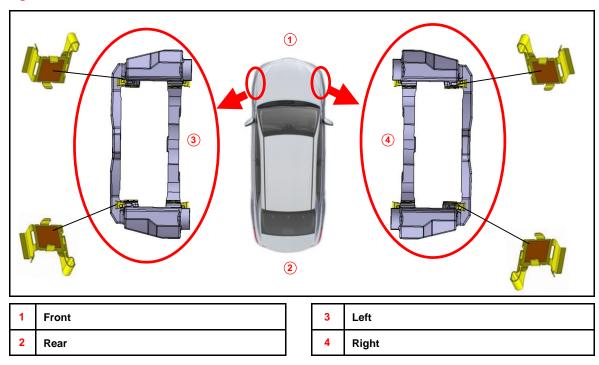

E. Install the front brake pads.

Refer to TIS, applicable model and model year Repair Manual:

- 2018 2020 Camry: General – Maintenance – "Maintenance: Front Disc Brake Pad: Installation"
- 3. Confirm the squeal/squeak noise is no longer present.