



Technical Service Bulletin

94 Static cornering lighting does not work

94 20 29 2050660/2 October 19, 2020. Supersedes Technical Service Bulletin Group 94 number 18-98 dated March 8, 2018 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q5, SQ5	2018	000001 - 023460	With LED headlamps

Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised header (Correct Elsa display issue)
1	03/08/2018	Initial publication

Customer states:

- The static cornering lighting does not work.

Workshop findings:

- The concern can be reproduced.
- In both light control modules (left and right), J1018 and J1023 (address word 00D6 and 00D7) there are no relevant DTCs logged.

Technical Background

The software needs to be updated.

Production Solution

New software in the vehicle electrical system control module, J519 (address word 0009) addressed the condition.

Service



Note:

This TSB only applies, if there are no relevant DTCs logged in **both** light control modules (left and right), J1018 and J1023 (address word 00D6 and 00D7) about the static cornering lighting.



Technical Service Bulletin

The concern can be fixed by updating the software of the vehicle electrical system control module, J519 (address word 0009) with SVM code.

SVM Update Instructions

1. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions*.
2. Update the vehicle electrical system control module, J519 (address word 0009) using the SVM action code as listed in the table below, if necessary:

Model	Old ZDC	Old ZDC Version	New ZDC	New ZDC Version (or higher)	SVM Code Input
Q5, SQ5	80B909471A	*	80B909471B	0004	09A039
Q5, SQ5	80B909472A	*	80B909472B	0004	09A039
Q5, SQ5	80B909514C	*	80B909514VC	0001	09A039
Q5, SQ5	80B909514D	*	80B909514VD	0001	09A039
Q5, SQ5	80B909514E	*	80B909514VE	0001	09A039

Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner.• If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9407		
Damage Code:	0040		
Diagnostic Time:	GFF – Checking and clearing fault codes included in existing labor operations	0150 0000	Time stated on the diagnostic protocol (Max 90 TU)
	Road test prior to service procedure	0121 0002	10 TU
	Road test after service procedure	0121 0004	10 TU
Claim Comment:	As per TSB #2050660/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.



Technical Service Bulletin

Additional Information

All parts and service references provided in this TSB (2050660) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2020 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.