

October 20, 2020

Version 1

Honda LogR™ App Activity Path is Broken

AFFECTED VEHICLES


Year	Model	Trim Level	VIN Range
2020	Civic Type R	ALL	SHHFK8.....200001 to SHHFK8.....200564

SYMPTOM

Activity paths logged in the Honda LogR™ smartphone app appear broken or incomplete. This may happen more often at lower elevations.

NOTICE

Image shown is an example only. The Honda LogR™ app is intended for use on race tracks and closed courses.

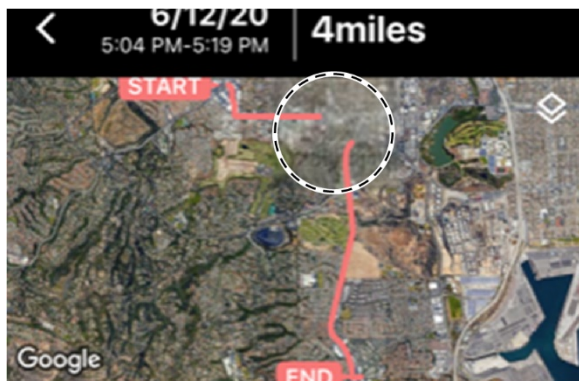

POSSIBLE CAUSE

There is outdated software in the Display Audio unit.

CORRECTIVE ACTION

Update the software in the Display Audio unit.

WARRANTY CLAIM INFORMATION

The normal warranty applies.


Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
0815A2	Update the software in the Display Audio unit.	0.3 hr	03214	03217	A20088A	39101-TGH-A81

Skill Level: Repair Technician

CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

REPAIR PROCEDURE

1. From your computer desktop, open the Honda Firmware Downloader. Refer to job aid *Honda Firmware Downloader* for additional information. Make sure to use an empty USB flash drive at least 3 GB in size, and formatted to FAT 32.
2. Enter service bulletin number 20-088 and the VIN, then follow the instructions to download the software to the USB flash drive.

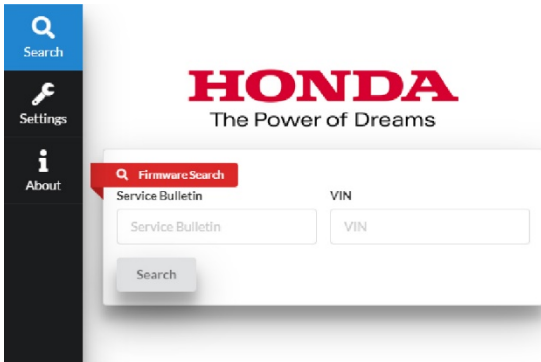

3. Take the USB flash drive to the vehicle.
4. Start the engine, or turn the ignition to ON and connect a fully charged battery jump box to avoid draining the battery.
5. Go to the home screen, and then insert the USB flash drive into the armrest USB port.




6. A pop-up appears after about **30-40 seconds**. Select **YES**.



The update will begin. The system will reboot several times during this process.




7. Once complete, the Anti-Theft screen appears. Press and hold the Power button to bypass.

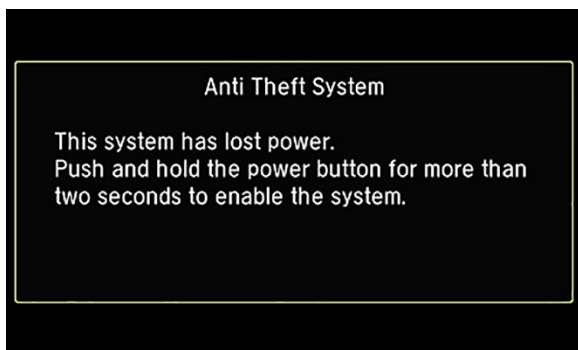

8. Once the pop-up appears, select **OK**.



9. Enter Diag Mode by pressing and holding the **PHONE**, **DAY/NIGHT**, and **VOL/POWER** buttons. Select **Detail Information & Setting**.

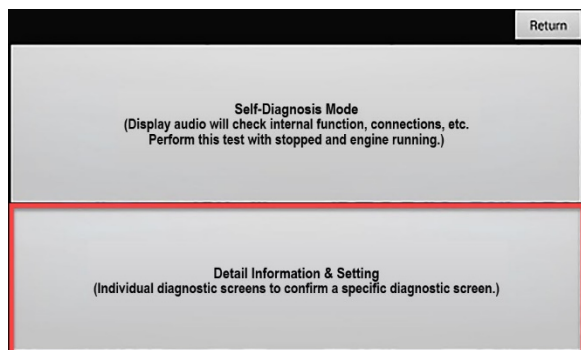

10. Select **Version**.

Return	
Monitor Check	B-CAN
Unit Check	F-CAN
Audio Check	Version
Guideline Setup	Vehicle status
Funcional Setup	GPS Information

11. Scroll to the bottom, and confirm that the software version is **1.F1A6.81**.

Return	
HUL G2P Engine 20.8.0	
HUL TTS Engine1.0.2	
VehicleDbManager1.0	
com.mitsubishielectric.ada.util.vehiclew4.2.2-83	
DBOOT	1.12_20200821020934
Software loader	1.F1A6.81
System µCom	H81F00 75.30.13

END