



A-Frame Additional Support

Bulletin Type:	Technical Service Bulletin TSB	Publication Date:	10/30/2020
Bulletin #:	20-026	Make(s):	Jayco TT
Job Code:	9801522	Model(s):	Eagle HT
Flat Rate:	1 Hour	Model Year(s):	2021

Incident:	When towing the trailer, the A-Frame may flex causing some distortion on the front cross-member.
Affected Units:	M1C2 0051-0074 M1C4 0051-0068 M1C7 0051-0074 M1C8 0051-0063
Parts:	Kit #: 20-026JT Contents: 1 ½" x 1 ½" x 51" square steel tube (11-12gauge) Supplier notes 1-3 day lead-time.
Misc. Tools & Supplies:	C-Clamps & Tape Measure Metal Saw & Steel Welder Wire Brush & Spray Paint (Black Rustoleum or Equivalent)

INSPECTION

- Verify the VIN is in the TSB scope. ALL affected units require this remedy.

INSTRUCTIONS

- Step 1: Center the 1 ½" Sq. Tube x 51" long (Item 47) below the front cross member (Item 15) and clamp into position as shown in Detail BD as shown in the attached frame drawings.
- Step 2: Weld Tube in position with 3" of weld spaced at 8" on center. Once one side is complete, weld the opposite side. See detail BD shown in the attached drawings.
- Step 3: Remove clamps and brush welded surfaces to remove any slag.
- Step 4: Touch up Paint with Rustoleum (or Equivalent).



