

REPLACES: Please discard bulletin MC20-05 dated July 9, 2020

TITLE: SERVICE ACTIVATION OF SELECT 2021 MODELS

SERVICE INFORMATION

SUBJECT


The 2021 Ninja® 1000SX and the Z H2 join the KLX™ 300R in requiring “service activation” in KVCS before delivery to the customer. On models with this function the engine warning indicator light on the instrument panel will flash when the ignition is first switched on during assembly & preparation and must be turned off using KVCS. The main purpose of this is to record the “service activation” date of the vehicle. Do not get confused by this indicator and attempt to diagnose a non-existent fault.



Z H2



NINJA 1000SX

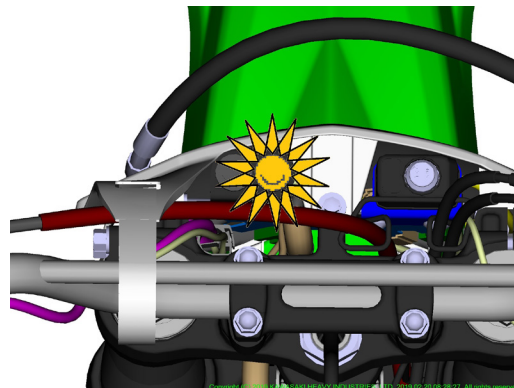


KLX300R

The service activation indicator light can only be deactivated by using the Service Activation Function in KVCS by entering the service activation date. Prior to customer delivery, use the following procedure to deactivate the service activation indicator light.

SERVICE ACTIVATION

Service Activation Procedure:

1. Start the KVCS software and click the FI ECU icon on the main menu screen.
2. Connect KVCS to the vehicle and turn the Ignition on.
3. Click the 'ECU Control' button.
4. Select delivery date of vehicle in the 'Service Activation' field. This should be the planned delivery date to the customer (when the vehicle is expected to be put into service).
5. Note that this date is not used to start the warranty period – the product registration is used for this.
6. Click 'Register' to complete service activation.

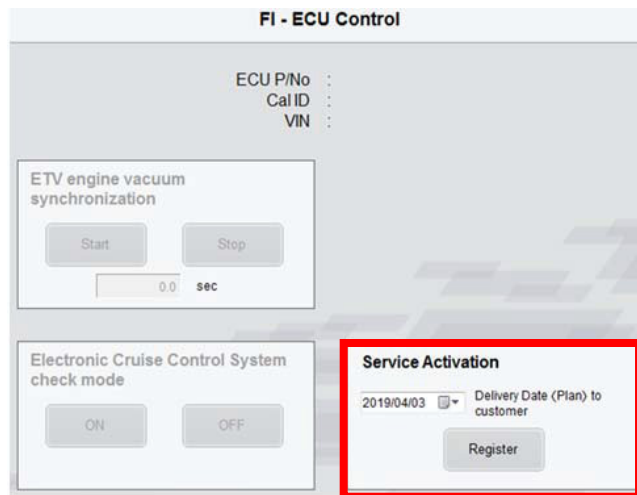

7. Confirm dealer code and password are correct and click 'Login' when prompted. The login details should have already been saved in KVCS Dealer Settings
8. When the 'Registered' confirmation message is displayed click 'OK' to complete the procedure.

NOTE:

- o Once the Service Activation mode is deactivated it cannot be reactivated.

For a video demonstration of this procedure, see [Service Activation](#) in the K-Tech Quick Tips in the K-Tech section of K-Dealer.